

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. E-1923	
7. Unit Agreement Name	
8. Farm or Lease Name South Wilson State Com.	
9. Well No. 1	
10. Field and Pool, or Wildcat Wilson (Morrow)	
12. County Lea	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL GAS WELL OTHER- _____

2. Name of Operator
TXO Production Corp.

3. Address of Operator
900 Wilco Bldg. Midland, Texas 79701

4. Location of Well
UNIT LETTER J, 1800 FEET FROM THE South LINE AND 1980 FEET FROM
THE East LINE, SECTION 14 TOWNSHIP 21-S RANGE 34-E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
3702 KB & 3700 DF & 3680 GL.

15. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-10-86 Kill well
Unseat packer, TOH

2-13-86 Set CIBP @ 12600, TIH w/tbg and dump 20sx on CIBP

2-14-86 Set 20sx plug @ 12,300'
Set 20sx plug @ 11,300'
Set 20sx plug @ 10,400'
Set 20sx plug @ 8100'
Set 50sx plug @ 5900' (to 5500')
TOH w/tubing

2-17-86 Free pt and cut 4-1/2" casing @ 4350'.
TIH w/tbg. Set 50sx @ 4-1/2" stub & 50' into 8-5/8"

2-18-86 Set 20sx plug @ 4800'
Set 50sx plug @ 4400'
Set 50sx plug @ 1700'
Set 35sx plug @ 530'
Set 10sx plug @ surface

2-19-86 Weld on plate and surface marker.
Well P&A'ed.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Alicia Henderson TITLE Engineering Assistant DATE 7-16-86

APPROVED BY R. A. Padilla TITLE OIL & GAS INSPECTOR DATE JUL 23 1986

CONDITIONS OF APPROVAL, IF ANY: