

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State  Fee

5. State Oil & Gas Lease No.  
LG-0048

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Union Oil Company of California	8. Farm or Lease Name Eaves Lea Unit State
3. Address of Operator P. O. Box 671 Midland, Texas 79702	9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>30</u> TOWNSHIP <u>21-S</u> RANGE <u>33-E</u> NMPM.	10. Field and Pool, or Wildcat Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 3,109' GR.	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK

TEMPORARILY ABANDON

PULL OR ALTER CASING

OTHER

PLUG AND ABANDON

CHANGE PLANS

SUBSEQUENT REPORT OF:

REMEDIAL WORK

COMMENCE DRILLING OPNS.

CASING TEST AND CEMENT JOB

OTHER

ALTERING CASING

PLUG AND ABANDONMENT

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1 - MI RU Casing Pulling Rig.
- 2 - Release tbg from pkr @ 14,252' (J-latch).
- 3 - Displace hole with 10 ppg brine.
- 4 - POOH w/tbg.
- 5 - Run CIBP on wireline & set @ 14,240'.
- 6 - RIH w/dump bailer and set 35' of cmt on top of CIBP.
- 7 - Stretch 5-1/2" OD csg - determine free point.
- 8 - Cut 5-1/2" OD csg above free point.
- 9 - POOH w/5-1/2" OD csg.
- 10 - RIH w/tbg to 50' inside csg - cut-off.
- 11 - Set 75 sx cmt plug.
- 12 - If csg cut off below 10,000' - spot 55 sx cmt plug @ 10,050'.
- 13 - If csg cut off below 9,000' - spot 55 sx cmt plug @ 9,035'.
- 14 - Pick up and spot 80 sx cmt plug @ 5,462'. *100' PLUG AT 7000'*
- 15 - Pick up and spot 75 sx cmt plug @ 1,575'.
- 16 - POOH & spot 10 sx cmt plug @ surface.
- 17 - Weld on 1/2" plate and install 4" x 4' dry hole marker - clean up location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. R. Hughes TITLE District Drilling Supt. DATE 2-10-82

APPROVED BY Jerry Sexton TITLE \_\_\_\_\_ DATE FEB 15 1982

CONDITIONS OF APPROVAL, IF ANY: