

SN at 3705', pkr at 3714'. Test sqz perfs 3774-3864. Swab, release pkr. RIH w/ 5 1/2" CICR to 3660'. Batch mix 100sx Cl C. Tail w/45sx Cl C, sqz 34sx into form. WOC 20 1/2 hrs. DO cmt f/3655 - 3869. Pressure test sqz to 500psi, ok. Swab. DO hard and soft cement f/3869-4054. Test squeeze perfs, ok. RIH w/2 7/8 production tbg to 4035'. TAC at 3689, SN at 3999', RIH w/pmp and rods. Space out hang on.