

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons Division
1625 N. French Jr.
Hobbs, NM 88240

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT --" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well: ☐ OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address and Telephone No. 205 E. Bender, HOBBS, NM 88240 397-0405

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Unit Letter C : 660 Feet From The NORTH Line and 1980 Feet From The
WEST Line Section 33 Township 21S Range 32E

5. Lease Designation and Serial No.

NM-86710

6. If Indian, Alottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and Number
BILBREY 33 FEDERAL

1

9. API Well No.
30-025-30781

10. Field and Pool, Exploratory Area
BILBREY ATOKA, (GAS)

11. County or Parish, State
LEA, NEW MEXICO

12. Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data

TYPE OF SUBMISSION	TYPE OF ACTION
☐ Notice of Intent	☐ Abandonment
☒ Subsequent Report	☒ Recompletion
☐ Final Abandonment Notice	☐ Plugging Back
	☐ Casing Repair
	☐ Altering Casing
	☒ OTHER: <u>Morrow Atoka</u>
	☐ Change of Plans
	☐ New Construction
	☐ Non-Routine Fracturing
	☐ Water Shut-Off
	☐ Conversion to Injection
	☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1-21-00: MIRU. SET IN FRAC TANKS.
1-24-00: LOAD TBG W/60 BBLS. ND TREE. NUBOP. REL & PULL BACK PSI VALVE
1-26-00: REL PKR. TIH W/CMT RET, SN, PU WS. STOP RET @ 8042'.
1-27-00: TIH W/RET TO 13,533'. TEST TBG TO 3500 PSI-OK. MIX & SPOT 50 SX CL H CMT. SQZ ATOKA PERFS 13630-637. REV OUT 60 SX CMT. PU BIT, DC'S & TBG. TAG UP @ 13,531'. DRILL 2' CMT. DRILL ON CMT RET.
1-31-00: LOWER TOOLS. DRILL CMT 13678-760. TAG RBP @ 13760'. TEST CSG & SQZ ON CHART FOR BLM TO 540# 30 MIN-OK. TIH W/RET TOOL & STOP TOOL @ 6200'. POSSIBLE RBP CEMENTED IN HLE.
2-01-00: TAG @ 13760'. WASH OVER RBP TO 13763'. FAILED TO CATCH RBP.
2-02-00: TIH W/OVERSHOT W/GRAPPLE, JARS, DC'S. TRY TO CATCH RBP. PUSH TO 13765'. LATCH ONTO FSH. LEFT OVERSHOT @ 3750'.
2-03-00: TIH W/TBG. TAG FSH @ 13725'. CAUGHT FSH.
2-04-00: RECVD ALL OF RBP. TIH W/OVERSHOT & SAME TOOLS. STOP @ 13497'.
2-07-00: LOWER O.S. TO 13768'. PUMP 16 BBLS 10# BRINE.
2-08-00: TAG @ 13768'. 41' ABOVE TOP OF FSH. NO HLE. TIH W/MILL, BMPR SUB, JARS, DC'S. STOP MILL @ 13500'.
2-09-00: MILL 13768-13779. STOP MILL @ 11750'.
2-10-00: PULL MILL TO 6500'.
2-11-00: TIH W/VARREL BIT, DC'S ON WS. TAG @ 13779'. DRILL HARD CMT 13779-13793. TAG ON TOP OF FSH 13793.
2-14-00: TIH W/SHOE, JARS, DC'S. STOP @ 11659'.
2-15-00: TIH W/TBG & TOOLS. TAG @ 13791'. WASH OVER FSH 13791-13870. TAG HARD 13870'.
2-16-00: TAG TOP OF FSH @ 13791. ROTATE OVER FSH & LOWER SHOE TO 13870. WASHOVER FSH 13870-13904. STOP SHOE @ 10000'.
Well TA'D 4/4/2000

14. I hereby certify that the foregoing is true and correct.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 4/12/00

TYPE OR PRINT NAME J. Denise Leake

(This space for Federal or State office use)

APPROVED [Signature] TITLE May 5 2000 DATE 4/12/00

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

RECEIVED
2008 APR 18 A 9 55

RECEIVED
2008 APR 18 A 9 55

2-17-00: TIH W/OVERSHOT, JARS, DC'S. STOP O.S. @ 8200'
2-18-00: TAG TOP OF FISH @ 13791'. LATCH ONTO FISH. UNABLE TO UNSET
PKR. STOP O.S. @ 4900'.
2-21-00: TIH W/KILL STRING TO 3100'.
2-23-00: TIH W/O.S., BMPR SUB, JARS, DC'S. CAUGHT TBG COLLAR JAR &
WRK ON FSH. JAR LOOSE. STOP TOOLS @ 2850'.
2-24-00: GRAPPLE TORE UP IN O.S. RECVD NO FSH. TIH W/SHOE, WP, JARS,
DC'S. STOP SHOE @ 11610'. CLOSE TO LINER TOP.L
2-25-00: TIH W/TBG FR 11610-13801. REWASH OVER TBG 13801-13908. CUT
OVER ON/OFF TOOL.
2-28-00: SHOE #1 WORE OUT. TIH W/SHOE #2. STIP SHOE @ 11610'.
2-29-00: TIH FR 13610-& TAG @ 13900. WASH OVER FISH 13900-08. CUT OVER
FISH 13908-13910.
3-01-00: TIH W/SHOE #3, WP, JARS, DC'S. STOP SHOE @ 11610.
3-02-00: TIH W/TBG & TOOLS FR 13610-13908. WASH OVER FSH 13908-13910.
PULL SHOE TO 11610.
3-03-00: WASH OVER FSH . STOP SHOE @ 13610.
3-06-00: RECVD IN WP, TBG ON/OFF TOOL, 6" PKR W/WL FSH INSIDE. TIH
W/SHOE #4, WP, JARS, DC'S. STOP SHOE @ 10861'.
3-07-00: TIH W/TBG FR 10866-13910. WSH OVER PKR @ 13910.
3-08-00: TIH W/SHOE #5. STOP SHOE @ 11610. HLE IN DERRICK LEG.
3-09-00: UNLOAD & SET UP EXTRA CATWALK & RACKS.
3-10-00: RD PU. RU PU W/NEW DERRICK. REP DRIVE LINE.
3-11-00: PU PROD TBG & RENTAL TBG. HU HYDRATOR TANK.
3-13-00: TIH FR 11610-13910. CUT OVER PKR 6".
3-14-00: RECVD NO FSH. SHOE WORE OUT. TIH W/SHOE #6 ON TBG. STOP @
11610'.
3-15-00: TIH FR 11610-13911. SHOE HANGING UP IN LINER.
3-16-00: TIH W/SHOE #7. STOP @ 11610.
3-17-00: TIH W/TBG FR 11610-13910.
3-20-00: SHOE WORE OUT. TIH W/3 3/4" SHOE STOP @ 11610.
3-21-00: TIH FR 11610-13912. WASH OVER PKR 13912-15'.
3-22-00: TIH W/SHOE #9. STOP @ 11610'.
3-23-00: TIH FR 11610-13912. DRY DRILL ON PKR. WASH OVER PKR 13912-15.
3-24-00: TIH W/SHORT CATCH O.S., JARS, DC'S. STOP @ 11610'.
3-27-00: TIH FR 11610-13915. TRY TO CATCH FSH. TIH W/SHOE #10, WP, JARS,
DC'S ON WS. STOP @ 11610.
3-28-00: DRY DRILL ON PKR. LOWER TOOLS & TRY TO CATCH PKR IN SHOE.
3-29-00: TIH W/SHOE #11. STOP @ 11610.
3-30-00: TIH FR 11610-13915. DRY DRILL ON PKR. TBG PLUGGED. CUT OVER
PKR 13915-13916. WILL START TA PROCEDURE.
3-31-00: TIH W/SHOE FR 11610-13916. DRILL ON PKR 13916-13917. STOP SHOE
@ 8200.
4-03-00: TIH W/CIBP, SN. SET CIBP @ 13903'. (70' ABOVE TOP MORROW PERF)
4-04-00: PRESS TEST CIBP & CSG. CHART TO 500#-30 MINS FOR BLM.
WITNESSED BY STEVE CAFFEY.

RECEIVED

SEP 18 1955

RECEIVED

RECEIVED
Books
100

4-05-00: TIH W/CMT BAILER ON WL. TAG PLUG @ 13903 & DUMP 25' CMT ON TOP OF PLUG. TIH W/SECOND RUN OF CMT. TAG CMT HIGH IN 5" LINER @ 13750'. SCATTERED CMT IN LINER. RIG DOWN WL.

4-06-00: TIH W/SN, PROD TBG. SET SN @ 13484. NDBOP. INSTL WRAP AROUND & DOUGHNUT & BTM OF 10,000# TREE. INSTL GATE VALVE W/BULLPLUG & NEEDLE VALVE.

4-07-00: RIG DOWN.

WELL IS TEMPORARILY ABANDONED.


FINAL REPORT

RECEIVED
JUN 18 1955

JUN 18 1955

RECEIVED

RECEIVED
HARRIS
JUN 18 1955

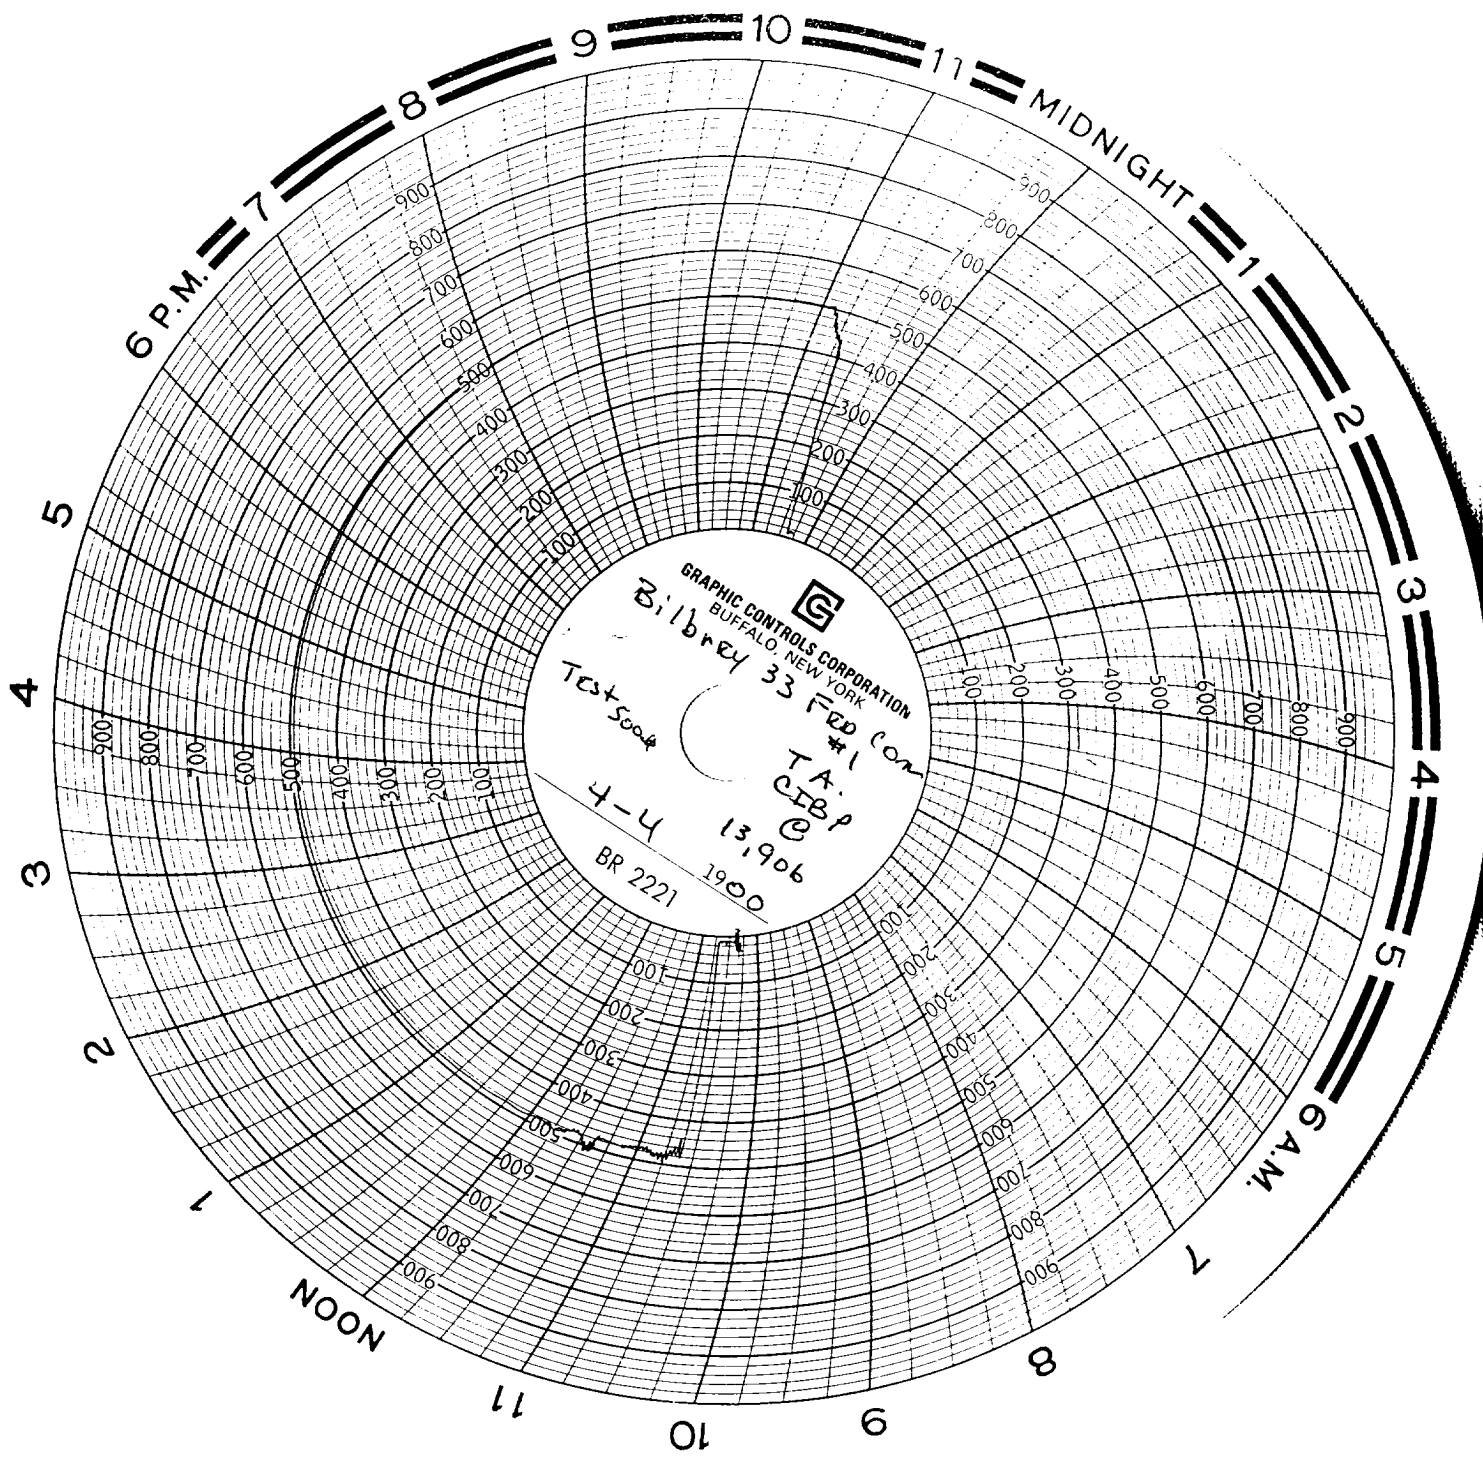

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK
Bilbrey 33 Fed Com
Test 5004
T.A.
CIBP
4-4 13,906
BR 2221 1900

RECEIVED
18 APR 1955

18 APR 1955

RECEIVED

4
Received
Hobbs
OCD