

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPI
(Other instructions
verse side)

TE
re

Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input type="checkbox"/> WATER WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> SWD-Well	5. LEASE DESIGNATION AND SERIAL NO. LC-063228
2. NAME OF OPERATOR Estacado, Inc.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 5587, Hobbs, New Mexico 88241	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990' FSL & 330' FWL Unit Letter "M"	8. FARM OR LEASE NAME Fields Federal
14. PERMIT NO.	9. WELL NO. 2
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3713 DF	10. FIELD AND POOL, OR WILDCAT Triste Draw Delaware
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 25, T-23-S, R-32-E NMPM
	12. COUNTY OR PARISH Lea
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Moved in, rigged up. Dug pit & installed BOP.
2. Picked up 161 jts of 2 3/8" work string & tagged CICR. Layed down 1 jt. & circulated hole clean & spotted 25' cement plug.
3. Pulled up hole to 4765' & spotted 100' cement plug.
4. POOH w/tubing & pressured up to 800#, casing would not hold.
5. Picked up 4 1/2" packer on 2 3/8" tubing & located hole at 400'. Layed tbg. down.
6. Rigged up wireline, ran in hole w/4 shots to 1175' & perforated casing.
7. Ran tubing in hole to 1000' & squeezed cement to surface between 7 5/8" & 4 1/2" valve. Opened 4 1/2" valve & brought cement to surface. Pumped 287 sx.
8. Dug cellar, cut wellhead off & installed P&A marker. Completed 2/9/89

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

President

DATE

3/1/89

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side