	E	State of No Energy, Minerals and Na		Form C-103 Revised 1-1-89		
DISTRICT I P.O. Box 1980, Hobbs NM 88240 DISTRICT II 811 S. 1st Street, Artesia, NM 88210-2834 DISTRICT II S. Indicate Type of Street, Artesia, NM 88210-2834						0-025-09039
811 S. 1st Street, Artesia, NM 88210-2834 <u>DISTRICT III</u> 1000 Rio Brazos Rd., Aztec, NM 87410					6. State Oil & Gas Le	STATE X FEE
					A-2614	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)					7. Lease Name or Un South Eunice	-
1. Type of Well: OIL WELL	GAS WELL	OTHER	Water	· Injection		
2. Name of Operator					8. Well No.	
Marathon 011 Company					420	
3. Address of Operator P.O. Box 2409, Hol	bbs, NM 8824	10			9. Pool name or Wild S. Eunice (7R	
4. Well Location Unit Letter	I : 1980	Feet From The	South	Line and 60	60 Feet From Th	neEastLine
Section	26	Township 22S	Ra	ange 36E	NMPM	Lea County
			w wheth	er DF, RKB, RT, GR, etc		
//////////////////////////////////////	Chook App	ropriate Box to Ind		456' GL; 3467' KB	Bonort or Oth	<u> </u>
		ENTION TO:	Icate	1 .	BSEQUENT R	
		ENTION 10.		502		
PERFORM REMEDIAL WO	DRK	PLUG AND ABANDON		REMEDIAL WORK		
TEMPORARILY ABANDO	N	CHANGE PLANS		COMMENCE DRILLING	BOPNS.	
PULL OR ALTER CASING	¥ 🗌					
			OTHER:			
work) SEE RULE 1	97, Marathon			ne plug and abando	nment of the abo	ve referrenced well
as per the fol 1. MIRU pull		wellhead. NU BOPE.	FILM	k up 1 jt 2 3/8" tl	bg and tag cemen	t plug at 2897'.
as per the fol 1. MIRU pull POOH and 2. RIH to 28	tally pipe. 1971. RU Hall	<pre>wellhead. NU BOPE. iburton and displac 25 sxs class C cem</pre>	e the	hole with 9# plug	ging mud. PUH 1	
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13	tally pipe. 1971. RU Hall 1991. Pumped	iburton and displac	e the lent an	hole with 9# plug nd flush for first	ging mud. PUH 1 plug.	aying down 47 jts
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'.	tally pipe. 897'. RU Hall 199'. Pumped ng down 22 jt	iburton and displac 25 sxs class C cem	e the lent an ped 50	hole with 9# plug nd flush for first) sxs class C cemen	ging mud. PUH 1 plug. nt and flush for	aying down 47 jts second plug at
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'. 4. POOH layi Charlie Perrin	tally pipe. 1977. RU Hall 1997. Pumped 19 down 22 jt 19 down the 1 with the NM	iburton and displac 25 sxs class C cem s tbg to 715'. Pum	e the ent an ped 50 umped luggin	hole with 9# plug nd flush for first) sxs class C cemen cement to fill the ng and approved.	ging mud. PUH 1 plug. nt and flush for	aying down 47 jts second plug at
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'. 4. POOH layi Charlie Perrin Welder will cu	tally pipe. 897'. RU Hall 199'. Pumped ng down 22 jt ing down the n with the NM it wellhead o	iburton and displac 25 sxs class C cem s tbg to 715°. Pum rest of the tbg. P OCD witnessed the p	e the ent an ped 50 umped luggin ll dry	hole with 9# plug nd flush for first) sxs class C cemen cement to fill the ng and approved. y hole marker.	ging mud. PUH 1 plug. nt and flush for	aying down 47 jts second plug at
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'. 4. POOH layi Charlie Perrin Welder will cu	tally pipe. 897'. RU Hall 199'. Pumped ng down 22 jt ing down the n with the NM it wellhead o	iburton and displac 25 sxs class C cem s tbg to 715'. Pum rest of the tbg. P OCD witnessed the p ff on 3/5 and insta	e the ent an ped 50 umped luggin ll dry	hole with 9# plug nd flush for first) sxs class C cemen cement to fill the ng and approved. y hole marker.	ging mud. PUH 1 plug. nt and flush for	aying down 47 jts second plug at
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'. 4. POOH layi Charlie Perrin Welder will cu	tally pipe. 197'. RU Hall 199'. Pumped 199 down 22 jt 199 down the 1 with the NM 1 wellhead o	iburton and displac 25 sxs class C cem s tbg to 715'. Pum rest of the tbg. P OCD witnessed the p ff on 3/5 and insta	e the ent an ped 50 umped luggin ll dry	hole with 9# plug nd flush for first) sxs class C cemen cement to fill the ng and approved. y hole marker.	ging mud. PUH 1 plug. nt and flush for e rest of the ca	aying down 47 jts second plug at sing.
as per the fol 1. MIRU pull POOH and 2. RIH to 28 tbg to 13 3. PUH layin 715'. 4. POOH layin Charlie Perrin Welder will cu	tally pipe. 197'. RU Hall 199'. Pumped 199 down 22 jt 199 down the 1 with the NM 1 wellhead o	iburton and displac 25 sxs class C cem s tbg to 715'. Pum rest of the tbg. P OCD witnessed the p ff on 3/5 and insta	e the ent an ped 50 umped luggin ll dry knowledg	hole with 9# plug nd flush for first) sxs class C cemen cement to fill the ng and approved. y hole marker.	ging mud. PUH 1 plug. nt and flush for e rest of the ca	aying down 47 jts second plug at sing.

