

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	State ☐	Fee ☒
5. State Oil & Gas Lease No.		

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name <i>South Eunice Unit</i>
2. Name of Operator <i>Conoco Inc.</i>	8. Farm or Lease Name <i>South Eunice Unit</i>
3. Address of Operator <i>P.O. Box 460 - Hobbs, New Mexico 88240</i>	9. Well No. <i>54</i>
4. Location of Well UNIT LETTER <i>H</i> <i>1980</i> FEET FROM THE <i>north</i> LINE AND <i>660</i> FEET FROM THE <i>east</i> LINE, SECTION <i>33</i> TOWNSHIP <i>22S</i> RANGE <i>36E</i> N.M.P.M.	10. Field and Pool, or Wildcat <i>Eunice 7 Rives Queen S</i>
15. Elevation (Show whether DF, RT, GR, etc.)	12. County <i>Lea</i>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER <i>Clean Out & Acidize</i> ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRR. POOH w/ rods & pump. Tag Jett w/ tag & tally out of hole.
 - 2) Clean well out to 3760' & POOH. Run csq scraper to 3760' & POOH.
 - 3) Set RBP at 3640' & pkr at 3550'.
 - 4) Acidize w/ 50 bbls 15% HCl-FE acid and w/ 50 gals Checker. Set or equivalent inhibited for 24 hrs at 100°F and 200# graded rock salt mixed in 3 bbls gelled 9# brine in 2 equal stages. Flush w/ 40 bbls 9# brine. Release pkr at 3550' & RBP at 3640'. Set RBP at 3760' & pkr at 3640'. Pump 50 bbls 15% HCl-FE acid w/ 50 gals Checker. Set or equivalent and 200# graded rock salt mixed in 3 bbls gelled 9# brine in 2 equal stages. Flush w/ 40 bbls 9# brine. Release pkr at 3640'. Swab well. Release RBP at 3760' & POOH.
 - 5) Land SN at 3700'. Run pump & rods. Place well on test.
- For further information call Jay Vashler at 397-5866.*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *DF Finney* TITLE *Administrative Supervisor* DATE *9/15/88*

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

APPROVED BY _____ TITLE _____ DATE *9/24/88*

CONDITIONS OF APPROVAL, IF ANY: