

COPIES RECEIVED	
DISTRIBUTION	
IT - FE	
E	
S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" FORM C-101 FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator E. P. Campbell (Aetna Life & Casualty, Bonding Agent) (108 E. 3rd., Roswell, New Mexico)		8. Farm or Lease Name Christmas
3. Address of Operator 1603 Broadway, Lubbock, Texas		9. Well No. 1
4. Location of Well UNIT LETTER C 660 FEET FROM THE N. LINE AND 1280 FEET FROM THE W LINE, SECTION 6 TOWNSHIP 23S RANGE 36E NMPM.		10. Field and Pool, or Wildcat Jalmat Yates
11. Elevation (Show whether DF, RT, GR, etc.) G. L. 3499		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-9-74 Moved in Pulling Unit, rigged up, prepared well for plugging.  
2-11-74 Pumped 25 sx cement plug to 3658' to 3383', plug tagged at 3383' with wire line measure.  
2-12-74 Cut casing at 2995', pumped down 50 sx plug across the stub at 2995' to 2823', pulled up to 1767' pumped 50 sx plug to 1595' at top of salt zone.  
2-13-74 Pumped 60 sx plug at 340' to 144', then spotted 10 sx plug at top, set well marker 15' to 0', cleaned up location, moved trucks to yard.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED E. P. Campbell TITLE W. R. Gottschall President DATE March 13, 1974

APPROVED BY Leslie A. Clements TITLE DATE  
CONDITIONS OF APPROVAL, IF ANY: