	DEPART, INTOF THE INTERIOR TOTAL TOTAL	Date: I m unproved. Budget Bureau No. 1004-0 Expires August 31, 1085-000 re- 5. Lease Designation and Seeial
SUN (Do not use this	BUREAU OF LAND MANAGEMENT NEW 1500 CONTROL OF THE PROPERTY OF	E. IF INDIAN, ALLOTTEE OF TRIBE N.
	х отнев	7. UNIT AGREEMENT NAME
CONOCO Inc.	8. FARM OR LEASE NAME Stevens B	
P.O. Box 460	- Hobbs, New Mexico 88240 port location clearly and in accordance with any State requirements.	9. WELL NO. 1 10. FIELD AND POOL, OR WILDCAT
660' FNL & 16	50' FWL - Unit Letter C	Jalmat Yates Gas 11. SEC., T., E., M., OR BLE. AND SURVEY OR AREA
4. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, CR, etc.) 30-025-09324		12-23S-36E 12. COUNTY OR PARISH 13. STATE
J.	Check Appropriate Box To Indicate Nature of Notice, Report,	Lea NM or Other Data
TEST WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL (Other)	501	RESIDUENT REPORT OF: REPAIRING WELL ALTERING CASING ABANDONMENT*
	 MIRU WS unit. A. Install BOP and pick up 2-3/8" workstring open ended B. RIH to 3550' and circulate hole full with 90 bbls of C. POOH and pick up 4-3/4" bit and 5-1/2" casing cleanout to 5-1/2" casing shoe at 2979'. RIH with 5-1/2" CIRP and set 8 20201. 	mud. scraper and
•	 RIH with 5-1/2" CIBP and set @ 2930'. Spot 35 ft. (4 of CIBP bringing TOC to 2895'. Spot 5 bbls 15% HCl-NE-11406'-1200'. 	sx.) on top FE acid from
	3. POOH with workstring and rig up wireline perforators. A. Load a 4" hollow carrier casing gun with 4 JSPF @	a 90 dogree ra
	phasing and .5" EHD with CCL. B. RIH to 1406' with perforating gun using the 7-5/8" s for correlation. C. Perforate the 5-1/2" casing at 1406' and POOH.	ourface shoe
	B. RIH to 1406' with perforating gun using the 7-5/8" s for correlation. G. Perforate the 5-1/2" casing at 1406' and POOH. 4. Close BOP and establish pump in rate down 5-1/2" casing.	purface shoe
	B. RIH to 1406' with perforating gun using the 7-5/8" s for correlation. C. Perforate the 5-1/2" casing at 1406' and POOH.	Surface shoe

*See Instructions on Reverse Side