

STEVENS B-1 #7
RECOMMENDATION TO TEMP ABANDON

This well is currently inactive. It is recommended the well be temporarily abandoned in order to evaluate possible up-hole potential.

Prepare well bore as follows:

1. POH with existing pump, rods and tubing.
2. Make scraper run inside 4.5", 9.5# casing to top perf of 3640'.
3. Set Cast Iron Bridge Plug within 50' of top perf, spot 35' of cement on top of CIBP.
4. Circulate casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give BLM 24 hrs notice prior to pressure test.