

**Stevens B #2**

**30-025-09332**

**Recommendation to Temp. Abandon**

This well is currently inactive. It is recommended that the well be temporarily abandoned while evaluating remedial work in the Jalmat Yates.

1. POOH tubing.
2. Make scraper run inside 5.5", 14# casing to 2948'.
3. Set Cast Iron Bridge Plug w/in 50' of end of casing @ 2900', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.