

IV. SUMMARY OF PROPOSED WORK:

It is recommended to clean out LLU No. 4, open 7-Rivers pay, and acidize the unitized interval as outlined below.

1. POOH w/rods and pump. NU BOPs. Tag for fill w/production string. POOH w/production string.
2. Clean out wellbore.
3. Run GR-CCL to correlate perforation runs.
4. Spot acid across 7-Rivers and Queen zones.
5. Perforate 7-Rivers (3578-90', 3499-3503', and 3517-26') w/2 JSPF, 180° phasing.
6. Breakdown all perfs w/acid. Swab back load. Return well to production.