

NEW MEXICO OIL CONSERVATION COMMISSION

Corrected

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
37721	
7. Unit Agreement Name	
8. Farm or Lease Name	
Paddock UNIT	
9. Well No.	
11	
10. Field and Pool, or Wildcat	
Paddock	
12. County	
Lea	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator
Exxon Company, USA
3. Address of Operator
P.O. Box 2100 Hobbs, New Mexico 88240
4. Location of Well
UNIT LETTER C, 660 FEET FROM THE N LINE AND 255 FEET FROM THE W LINE, SECTION 2 TOWNSHIP 22-5 RANGE 37-E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-23-83 Spot 30 sacks of class c cement at 5070'.
4-25-83 Go in hole to 5070' and did not tag plug.
4-25-83 Spot 30 sacks of class C cement at 5070'.
4-26-83 Tag plug @ 4982'.
4-26-83 Mixed mud and circulated hole.
4-26-83 Spot 30 sacks @ 3900'.
4-26-83 Spot 30 sacks @ 2600'.
4-27-83 Perf. 5½" casing @ 1250'. Set packer @ 950'.
4-27-83 Circulate cement out backside of 5½" casing.
4-28-83 Tag plug inside of 5½" casing @ 1140'.
4-28-83 Install 10 sacks of cement for top plug. Weld on steel plate with marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. F. Lowe TITLE SR ADMIN DATE 5-10-83
APPROVED BY Edd W. [Signature] (AAP) TITLE OIL & GAS INSPECTION DATE AUG 10 1983
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

MAY 13 1983

G.C.D.
HOBBS OFFICE