		of New M	CAICO		F	orm C-
Office District I	Energy, Minera	als and Nat	ural Resources	·	Revised M	
1625 N. French Dr., Hobbs, NM 88240				WELL API NO		
<u>District II</u> 811 South First, Artesia, NM 88210	OIL CONSE	RVATIO	NOIVISION	30-C	25-1001	6
District III	2040	South Pag	checo	5. Indicate Typ	·	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa	Fe, NM 8	7505	STATE		
2040 South Pacheco, Santa Fe, NM 87505		,		6. State Oil &	Gas Lease No.	,
SUNDRY NOT	ICES AND REPORTS	ON WELL	<u>s</u>	7. Lease Nam	e or Unit Agree	mentNa
(DO NOT USE THIS FORM FOR PROPOS	SALS TO DRILL OR TO D	EEPEN OR PL	UG BACK TO A	7. Louise Huil	io or omerigion	JIII CII (1
DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	CATION FOR PERMIT" (FO	ORM C-101) F	OR SUCH	Brunson	Z	
1. Type of Well:				Drunson	, 0	
Oil Well 🔀 Gas Well	Other					
2. Name of Operator		••		8. Well No.		
	A WTP Limited Partner	rship	192463	0 Daal	XX 2 2 3 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	
3. Address of Operator P.O. BOX	50250 MIDLAND, 7	Γχ 7971∩₋		9. Pool name o	r Wildcat	
4. Well Location	SUZSU MIDLAND,	121 ///10-	0230	Mantz	700	
			_		_	
Unit Letter:_	1980 feet from th	16 <u>>orf</u>	line and 2	feet fi	rom the Es	1 1
Section 4	Townshin	775 P	ange 3TF	NMPM	County	
Section			R, RKB, RT, GR, etc.)		County	
	,			•		
11. Check A	ppropriate Box to	Indicate N	ature of Notice, R	eport or Othe	r Data	
NOTICE OF IN	TENTION TO:			EQUENT RI		
PERFORM REMEDIAL WORK	PLUG AND ABANDO	DN 🔲	REMEDIAL WORK		ALTERING	
TEMPORARILY ABANDON	CHANGE PLANS	\Box	COMMENCE DRILL	ING ODNS	PLUG AND	
	JIMOL I LANG	<u></u>	COMMENCE DRILL	NG OFINS. [_]	ABANDONI	MENT
PULL OR ALTER CASING	MULTIPLE		CASING TEST AND	·		
	COMPLETION		CEMENT JOB			
OTHER:			OTHER:			
(O. D 1.	ed operations. (Clearly	state all per	tinent details, and giv	e pertinent dates	s, including estin	mated d
12. Describe proposed or complete			~ • • • • • • •	111 11	n of proposed of	ompletic
of starting any proposed work). or recompilation.	SEE RULE 1103. Fo	or Multiple (Completions: Attach	wellbore diagran	ii or proposed et	
of starting any proposed work).	SEE RULE 1103. Fo	or Multiple (Completions: Attach v	vellbore diagran	n or proposed ed	•
of starting any proposed work). or recompilation. BRUNSON B-1						•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INTERPRETATION	TENT TO PSA 10/2	11/00.) 1	MIRU PU 10/12/0	O, RDWH, NU	J BOP. RIH	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT & SET CIBP @ 6675'	TENT TO P& 10/1	11/00. R	MIRU PU 10/12/0 IH & TAG @ 6640	0, RDWH, NT ', SPOT 9.5	J BOP. RIH 5#MLF FROM	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT & SET CIBP @ 6675' 6640-5530', POOH.	TENT TO P&A 10/1, SPOT 5sx CMT, RIH & SET CIBP	11/00. R WOC. R @ 5530'	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT,	0, RDWH, N 7, SPOT 9.5 WOC. RIH	J BOP. RIH 5#MLF FROM & TAG @	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO	TENT TO P&A 10/: , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @	11/00. R WOC. R @ 5530' 194-4953 5031', S	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W,	0, RDWH, NU ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ ,	J BOP. RIH S#MLF FROM & TAG @ Ssx CMT W/ POOH, WOC.	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516',	TENT TO P& 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V	WOC. R. @ 5530' @ 494-4953 5031', S	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC.	0, RDWH, NT ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG	J BOP. RIH 5#MLF FROM & TAG @ 5sx CMT W/ POOH, WOC. @ 4427',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 25	TENT TO P& 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT W & CaCl2, POOH, W	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045'	0, RDWH, NT ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG	J BOP. RIH 5#MLF FROM & TAG @ 5sx CMT W/ POOH, WOC. @ 4427',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PER	TENT TO P&A 10/1, SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54. RIH & TAG @ SPOT 45sx CMT W CaCl2, POOH, W RF @ 2938', M&P	11/00. R WOC. R @ 5530' 194-4953 5031', S V/ 2% Cac OC. RIF 45sx CM	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 PPOT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045', I', POOH, WOC.	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG , CIRC HOLE RIH & TAG @	J BOP. RIH 5#MLF FROM & TAG @ 5x CMT W/ POOH, WOC. @ 4427', W/ 9 2730',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PER SPOT 25sx CMT W/ 29	TENT TO P&A 10/1, SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54. RIH & TAG @ SPOT 45sx CMT W CaCl2, POOH, W RF @ 2938', M&P CaCl2, POOH, W	WOC. R. @ 5530' 194-4953 5031', S. N/ 2% Cac OC. RIF 45sx CM	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 PPOT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045', I', POOH, WOC.	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG , CIRC HOLE RIH & TAG @ , RIH & PER	J BOP. RIH 5#MLF FROM & TAG @ 5xx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PER	TENT TO PAR 10/1, SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V Cacl2, POOH, WRF @ 2938', M&P Cacl2, POOH, WC CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac COC. RIH 45sx CM COC. RIH COC. RIH COC. RIH	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POOT 50sx CMT W, Cl ₂ , POOH, WOC. [& TAG @ 4045', I', POOH, WOC. [& TAG @ 2195', 10/21/00. DUG	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG , CIRC HOLE RIH & TAG @ , RIH & PER OUT CELLAR	J BOP. RIH 5#MLF FROM & TAG @ 5xx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 2% 9.5#MLF. RIH & PEI SPOT 25sx CMT W/ 2% M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO PAR 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V & CaCl ₂ , POOH, W RF @ 2938', M&P & CaCl ₂ , POOH, W C CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac OC. RIH 45sx CM OC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 EPOT 50sx CMT W, Cl ₂ , POOH, WOC. [& TAG @ 4045', I', POOH, WOC. [& TAG @ 2195', 10/21/00. DUG	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG @ RIH & PER OUT CELLAR ELL P&A'D.	J BOP. RIH 5#MLF FROM & TAG @ 5xx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 2% 9.5#MLF. RIH & PEI SPOT 25sx CMT W/ 2% M&P 120sx CMT, CIRC	TENT TO PAR 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V & CaCl ₂ , POOH, W RF @ 2938', M&P & CaCl ₂ , POOH, W C CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac OC. RIH 45sx CM OC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 EPOT 50sx CMT W, Cl ₂ , POOH, WOC. [& TAG @ 4045', I', POOH, WOC. [& TAG @ 2195', 10/21/00. DUG	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG @ RIH & PER OUT CELLAR ELL P&A'D.	J BOP. RIH 5#MLF FROM & TAG @ 5xx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PEI SPOT 25sx CMT W/ 29 M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO PAR 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V & CaCl ₂ , POOH, W RF @ 2938', M&P & CaCl ₂ , POOH, W C CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac HOC. RIF 45sx CM HOC. RIF COC. RIF E. RDPU RKER, CLI	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG , CIRC HOLE RIH & TAG @ , RIH & PER OUT CELLAR ELL P&A'D. and belief.	J BOP. RIH 5#MLF FROM & TAG @ 5sx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364', 2, CUT OFF	•
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 2% 9.5#MLF. RIH & PEI SPOT 25sx CMT W/ 2% M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO PAR 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V & CaCl ₂ , POOH, W RF @ 2938', M&P & CaCl ₂ , POOH, W C CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac OC. RIH 45sx CM OC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH COC. RIH	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 / 2% CaCl ₂ , RIH & TAG , CIRC HOLE RIH & TAG @ , RIH & PER OUT CELLAR ELL P&A'D. and belief.	J BOP. RIH 5#MLF FROM & TAG @ 5xx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PER SPOT 25sx CMT W/ 29 M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO PAR 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT V & CaCl ₂ , POOH, W RF @ 2938', M&P & CaCl ₂ , POOH, W C CMT TO SURFACE	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac HOC. RIF 45sx CM HOC. RIF COC. RIF E. RDPU RKER, CLI	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG RIH & PER OUT CELLAR ELL P&A'D. and belief.	DATE	22(01
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PER SPOT 25sx CMT W/ 29 M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO P&A 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT W CAC12, POOH, W CAC12, POOH, W CAC12, POOH, W CCMT TO SURFACE ALL DRY HOLE MAR	11/00. R WOC. R @ 5530' 194-4953 5031', S W/ 2% Cac HOC. RIF 45sx CM HOC. RIF COC. RIF E. RDPU RKER, CLI	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG RIH & PER OUT CELLAR ELL P&A'D. and belief.	J BOP. RIH 5#MLF FROM & TAG @ 5sx CMT W/ POOH, WOC. @ 4427', W/ 9 2730', F @ 364',	22/01
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675' 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 29 9.5#MLF. RIH & PEI SPOT 25sx CMT W/ 29 M&P 120sx CMT, CIRC WH & ANCHORS, INSTE	TENT TO P&A 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT W CAC12, POOH, W CAC12, POOH, W CAC12, POOH, W CCMT TO SURFACE ALL DRY HOLE MAR	11/00. R. WOC. R. WOC. R. S530' 494-4953 5031', S W/ 2% Cac HOC. RIF 45sx CM HOC. RIF COC. RIF COC. RIF TOC. RIF TITLE	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POOT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W Dest of my knowledge REGULATORY AN	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG RIH & PER OUT CELLAR ELL P&A'D. and belief.	D BOP. RIH S#MLF FROM & TAG @ Sex CMT W/ POOH, WOC. @ 4427', W/ @ 2730', F @ 364', R, CUT OFF DATE 3/2	685-57
of starting any proposed work). or recompilation. BRUNSON B-1 NOTIFY NMOCD OF INT. & SET CIBP @ 6675', 6640-5530', POOH. 5494', POOH. SPOT 2% CaCl ₂ , POOH, WOO RIH & TAG @ 4516', SPOT 45sx CMT W/ 2', 9.5#MLF. RIH & PER SPOT 25sx CMT W/ 2', M&P 120sx CMT, CIRC WH & ANCHORS, INSTA	TENT TO P&A 10/1 , SPOT 5sx CMT, RIH & SET CIBP 9.5#MLF FROM 54 C. RIH & TAG @ SPOT 45sx CMT W CAC12, POOH, W CAC12, POOH, W CAC12, POOH, W CCMT TO SURFACE ALL DRY HOLE MAR	11/00. R. WOC. R. WOC. R. S530' 494-4953 5031', S W/ 2% Cac HOC. RIF 45sx CM HOC. RIF COC. RIF COC. RIF COC. RIF TITLE	MIRU PU 10/12/0 IH & TAG @ 6640 , SPOT 5sx CMT, '. POOH TO 514 POT 50sx CMT W, Cl ₂ , POOH, WOC. I & TAG @ 4045' I, POOH, WOC. I & TAG @ 2195' 10/21/00. DUG EAN LOCATION, W	0, RDWH, NO ', SPOT 9.5 WOC. RIH 0', SPOT 25 ' 2% CaCl ₂ , RIH & TAG CIRC HOLE RIH & TAG RIH & PER OUT CELLAR ELL P&A'D. and belief.	DATE	685-57