

**ATTACHMENT TO FORM C-105
COLLINS & WARE, INC.
CORRIGAN, H. #11**

26. Perforation Record.

7538 - 7570	4 SPF (128 shots)	11/47	Brunson Ellenburger
7466 - 7510	4 SPF (176 shots)	01/50	Brunson Ellenburger
7410 - 7445	4 SPF (140 shots)	04/50	Brunson Ellenburger
5555 - 5765	(780 shots)	04/54	Blinebry
5270 - 5292	(2 SPF)	04/75	Paddock
5207 - 5221	(8 holes)	04/75	Paddock
5176 - 5186	(2 SPF)	04/75	Paddock

27. Treatment Record.

7538 - 7570	AT with 1000 gals Western 15% LT acid.
7520	Set plug at 7520 with 3' cement on top. Top of cement 7517. 1/50
7466 - 7510	AT with 2000 gals Western 15% LT acid. 2/50
7460	Set Baker Model K Mag retainer at 7460' and dump 1 sx cement to 7453'.
7410 - 7445	AT with 500 gals 15% low surface tension acid.
7453 - 7460	Drill out CIBP and cement. 4/54
7517 - 7520	Drill out cement and bridging plug. Push junk to 7570'. 4/54
5660 - 5765	AT with 500 gals 15% LST acid. 4/54
5555 - 5645	AT with 500 gals Western 15% LST acid. 4/54
5555 - 5765	FT with 5000 gals gel and 2500# sand. 4/54
7345	Set plug at 7345' and dump 5 sx cement on top. Top of cement at 7300. 4/75
5505	Set CIBP at 5505 with 2 sx cement on top. Top of cement at 5495. 4/75
5270 - 5292	AT with 1000 gals 15% NEA acid. 4/75
5250	Set CIBP at 5250 with 2 sx sand on top.
5207 - 5221	AT with 1500 gals 15% NEA acid. 4/75
5200	Set CIBP at 5200 with 1 sx sand on top. Top of sand 5194'.
5176 - 5186	AT with 1500 gals 15% NE acid. 4/75
5200	Drilled out CIBP. 7/75
5250	Drilled out CIBP at 5250. Pushed plug to 5326. 7/75
5120	Set CIBP at 5120. 12/91
5120	Drilled out CIBP and pushed to 5487'. 1/98
5176 - 5292	AT with 3000 gals HCL Ferchek SC acid. 1/98