

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501Form C-103
Revised 10-1-7

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	For <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name S. Penrose Skelly Unit
2. Name of Operator Gulf Oil Corporation	8. Farm or Lease Name
3. Address of Operator P. O. Box 670, Hobbs, NM 88240	9. Well No. 112
4. Location of Well UNIT LETTER <u>F</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>5</u> TOWNSHIP <u>22S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat Penrose Skelly
15. Elevation (Show whether DF, RT, GR, etc.) 3451' GL	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

OTHER Repair Casing

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

POH with production equipment. Set RBP at 3000', test 500#. Cap RBP with 10' frac sand. Perf 1210' with (4) 1/2" 90° JHPF. Establish circulation down casing and up 8-5/8"-6" annulus. Set cement retainer at 1110', test tubing 3000#. Pump 300 sacks Class "C" with 4% gel and CaCl₂ plus 100 sacks Class "C" neat. When cement circulates, close casing valve and squeeze. Wait on cement. Drill out cement retainer and cement; test casing 500#. Wash sand off RBP and POH. Clean out to TD if necessary. Acidize with 3000 gals 15% NEFE HCL, 300# rock salt. CI well 1 hr. Open well and test. GIH with tubing, rods and pump. Hang well on.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED

R. D. PitreTITLE Area EngineerDATE 6-10-83

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT SUPERVISOR

TITLE

DATE JUN 14 1983

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JUN 13 1998
O.C.B.
HOMES OFFICE

RECEIVED
JUN 13 1998
O.C.B.
HOMES OFFICE