

C. P. FALBY "A" FEDERAL WELL NO. 2  
EUMONT YATES SEVEN RIVERS QUEEN  
LEA COUNTY, NEW MEXICO

Continuation to Form 3160-3

11. Bleed tubing pressure back at  $\pm$  10 GPM to allow fracture closure.
12. TOH w/packer.
13. TIH w/bit and clean out 7" casing to CIBP. TOH.
14. TIH w/production equipment.
15. Allow production to stabilize. Obtain DHC from NMOCD.
16. MIRU. Pull rods and pump.
17. Install BOP and pull tubing.
18. TIH w/bit and drill out CIBP located @ 3200'. Clean out to TD. TOH.
19. TIH w/production equipment and return to production as a DHC Penrose Eumont well.