

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		7. Unit Agreement Name	
2. Name of Operator Bliss Petroleum, Inc.		8. Farm or Lease Name J. L. Greenwood	
3. Address of Operator P. O. Box 1817 Hobbs, N.M. 88240		9. Well No. 5	
4. Location of Well UNIT LETTER <u>I</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>9</u> TOWNSHIP <u>22S</u> RANGE <u>37E</u> N.M.P.M.		10. Field and Pool, or Wildcat Eumont-Yates-7R-On.	
15. Elevation (Show whether DF, RT, GR, etc.) 3427 GL		12. County Lea	

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
☐

REMEDIAL WORK ☒  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐  
☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 2-24-86: 1. MIRU DA&S Unit 671  
2. Blew well down. Ran 1 1/4" sinker bar w/jars down 2 7/8" tbg. Stopped @ 3100'. Tbg. plugged 317' above pkr.  
3. RU Western. Pumped 500 gal. 20% NEFE acid dwn tbg followed w/5 Bbl. 2% KCL wtr.. Let soak 5 min. Pumped another 3 BW & tbg. press. up to 300#. Press. up intermit. during next 30 min. & press. went to 2000#. Pumped thru plug & press. went to zero.
- 2-25-86: 4. Swabbed back to tanks. Rec. 1/2 BO & 3 BLW in 4 hrs. Have 33 BLWTR.  
5. Started flowing to tanks. Rig dwn well service unit. Returned to producing.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Paul Bliss TITLE President DATE 3-6-86

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT 1 SUPERVISOR

TITLE

DATE

APR 4 - 1986

CONDITIONS OF APPROVAL, IF ANY: