STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

MO. OF COPICS ACCEIVED	7	
DISTRIBUTION	1	
SANTA FE	1-	
FILE	1	l —
U.S.O.S.	 	
LAND OFFICE	+-	
0.02		

ł	OISTBIBLITION		
į.	DISTRIBUTION	P. O. BOX 2088	Form C-103
- 1	SANTA FE	SANTA FE, NEW MEXICO 87501	Rovised 10-1
}	FILE		
- 1	U.S.G.S.		Sa. Indicate Type of Lease
}	LAND OFFICE		State Fee XX
Ĺ	MOTARES		5. State Oil 6 Gas Lease No.
	SUN	IDRY NOTICES AND REPORTS ON WELLS	mmmmmmm
		PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.	
1.	اله ال		7. Unit Agreement Name
v	شدلع شد ا	OTHER BELLEVILLE TO THE THE STATE OF THE STA	rigide ment stante
2. Nor	ne of Operator	Manual De a Decida Company	
Chevron U.S.A. Inc.		8. Farm or Lease Name	
3. Address of Operator		Rollon Brunson	
P.O. Box 670, Hobbs, NM 88240		9. Well No.	
	ation of Well	, MI 00240	5
			10. Field and Pool, or Wildcat
U	HIT LETTERG	2086 FEET FROM THE North LINE AND 2086	Paddock
			mmmmmm
T	East LINE, SE	CTION 10 TOWNSHIP 22S RANGE 37E	
~~		RANGE NMPM.	
////		15. Elevation (Show whether DF, RT, GR, etc.)	
<i>i]]]]</i> ;		3412	12. County Lea
16.	Chas		
	NOTICE	k Appropriate Box To Indicate Nature of Notice, Report or Oth	ier Data
	NOTICE OF	INTENTION TO: SUBSEQUENT	REPORT OF:
PERFO	M REMEDIAL WORK	PLUG AND ABANDON REMEDIAL WORK	
TEMPO	PARILY ABANDON	COMMENCE DRILLING OPNS.	ALTERING CASING
PULL 0	A ALTER CASING	CHANGE PLANS CASING TEST AND CEMENT JOB	PLUG AND ABANDONMENT
	ER	MAN AND AND AND AND AND AND AND AND AND A	L
ОТН			
ОТН			
7. Des	cribe Proposed or Completed kj seg Rule 1103.	Operations (Clearly state all pertinent details, and give pertinent dates, including of	estimated date of starting any propose
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	Operations (Clearly state all pertinent details, and give pertinent dates, including of the BOP, Ran CIBP and set at 5055, cap w/35' cement. The BOP, Ran CIBP and set at 5055, cap w/35' cemen	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,
LD to tu Ra pl PO	rods and pump. No 5000, circulate he bing 2660, spot 10 no tension pkr to 9 ugging. POH, ran H, run tubing OE to f report. Work pe	NU BOP, Ran CIBP and set at 5055, cap w/35' cement. nole w/mud. Pull tubing 3740', spot 100' cement plu 00 cement plug 2660-2560, POH, ran pkr, perf 7" csg 010, ppd thru perfs, No bleed off, OCD rep agreed to Howco C rtnr,2 3/8" tbg set 910, cap c retainer w/1 co 120, spot 120' surface plug, POH, RD, PU, install erformed 8-19-87 thru 8-20-87	Ran 2 3/8" tbg ag 3740-3640, pull at 1000' w/4 JHPF, proceed with 00'cement plug., well marker.,

OIL & GAS INSPECTOR

Staff Drilling Engineer

.... NOV 1 9 1987

October 13, 1987