

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 87240

District II

811 South First, Artesia, NM 87210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

2040 South Pacheco

Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-10225	
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name Thomas Long	
8. Well No. 4	
9. Pool name or Wildcat Drinkard	
4. Well Location Unit Letter <u>L</u> : <u>1650</u> feet from the <u>South</u> line and <u>990</u> feet from the <u>West</u> line Section <u>11</u> Township <u>22S</u> Range <u>37E</u> NMPM County <u>Lea</u>	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3368.5' RT	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOBS ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work). SEE RULE 1103. For Multiple Completions: Attach diagram of proposed completion or recompletion.

See Attached Sheet

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ronnie H. Westbrook TITLE Vice President DATE 01/30/2003

Type or print name Ronnie H. Westbrook

Telephone No. (915)684-6631

(This space for State use)

APPROVED BY GARY W. WINK ORIGINAL SIGNED BY GARY W. WINK DATE FEB 01 2003

Conditions of approval, if any:

PLUGGING AND ABANDONMENT PROCEDURES

JOHN H. HENDRIX CORPORATION

THOMAS LONG NO. 4

1650' FSL & 990' FWL Section 11, T22S, R37E, Lea County, New Mexico
Unit Letter L

Elevation: 3367' DF

Casing: 13-3/8" at 275' – 300 sx. – Circ.
8-5/8" at 2788' – 1250 sx.
5-1/2" at 6421' – 300 sx.

Drinkard Perfs: 6340 – 6378'

Note – Well has parted and/or collapsed casing at 4775' – Unable to get below 4775'.

P&A PROCEDURE

1. Move and rig up P&A equipment, dig and line pit.
2. Run tbg. and pkr. to 4650' and establish injection rate. If unsuccessful, call WPI Office.
3. Squeeze interval below retainer w/ 200 sx.
4. Circulate hole with 9.5 mud fr. retainer to surface.
5. Cut and pull csg. fr. 2888'.
6. Set 200 sx. plug fr. 2888'. — BASE OF SALT
7. Tag top of plug at approx. 2388' or higher.
8. Circulate hole w/ 9.5# mud.
9. Perf. 8-5/8" at 325'.
10. Circulate cement down 8-5/8" and up 8-5/8" – 13-3/8" annulus leaving 8-5/8" csg. full of cement.
11. Cut off well head.
12. Install P&A marker.
13. Rig down & move.

→ SET 100SX PLUG F/1100' to 1000' – TOP OF SALT

11-11-ED
Hicks
000