

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-76

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR P. L. BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER
2. Name of Operator
Texaco Producing Inc.
3. Address of Operator
PO Box 728, Hobbs, New Mexico, 88240
4. Location of Well
UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM
THE West LINE, SECTION 26 TOWNSHIP 22S RANGE 37E N.M.P.M.
15. Elevation (Show whether D.F., RT, CR, etc.)
NF-3330

7. Unit Agreement Name
8. Farm or Lease Name
Baker A
9. Well No.
4
10. Field and Pool, or Wildcat
Langlie Mathis
SP. Q. 68
12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPERATIONS ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up pulling unit and install BOP.
2. TIE with workstring and bit. Drill out CIBP at 3700' and clean out wellbore to TD (6430').
3. Circulate wellbore with 9.5 ppg mud.
4. Set a 200' cement plug from TD-6230'. This plug will be situated across the 5 1/2" casing shoe and above the Drinkard perforations at 6384'-6405'.
5. Pull up and set a 100' cement plug from 3363'-3463' above Queen perforations at 3488'-3647'.
6. Pull up to 2300' and set a 100' cement plug from 2800'-2700' across 8 5/8" casing shoe.
7. Set a 100' cement plug from 1075'-1175' above salt section at 1200'.
8. Set a 10' cement plug at the surface.
9. Install a dry hole marker. P: A.

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

TITLE AREA SUPERINTENDENT

DATE OCT 25 1988

NOV 28 1988