

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

O+2 - NMOCD - P.O. Box 1980 1 - Foreman
Hobbs, NM 88240 C.R.M.
1 - Engr. PJB 1 - File
1-Laura Richardson

Form C-103
Revised 10-1-70

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER	5a. Indicate Type of Lease State ☐ For ☒
2. Name of Operator Getty Oil Company	7. Unit Agreement Name J.V. Baker (Bty 2)
3. Address of Operator P.O. Box 730 Hobbs, NM 88240	8. Farm or Lease Name
4. Location of Well UNIT LETTER <u>A</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>330</u> FEET FROM THE <u>East</u> LINE, SECTION <u>27</u> TOWNSHIP <u>22S</u> RANGE <u>37E</u> N.M.P.M.	9. Well No. 10
	10. Field and Pool, or Wildcat Drinkard
15. Elevation (Show whether DF, RT, GR, etc.) 3339' DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up pulling unit. Install BOP.
2. With a wireline unit, set a CIBP at + 4400'. Dump 10' cement on plug. (Bad casing and fish in hole @ + 4470').
3. GIH with casing gun and perf 2 holes at 2700'. POH w/perforating gun.
4. GIH with cement retainer on 2 3/8" workstring.
5. Set retainer at + 2400'.
6. Cement through perfs at 2700' and circulate cement to surface. Cement as per Halliburton's recommendations.
7. Pull off retainer. POH and WOC.
8. GIH with 2 3/8" workstring to + 1200'.
9. Place a 100 sx. cement plug at 1200' as per Halliburton's recommendation. WOC.
10. POH.
11. Place a 10 sx. cement plug at the surface.
12. Weld 1" cap on casing and install P&A marker.

THE OPERATOR MUST BE NOTIFIED 24
HOURS BEFORE THE BEGINNING OF
WORK AND MUST FILE THIS FORM WITH THE OCS

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Area Superintendent DATE 3/4/83
DATE E. Crockett

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

APPROVED BY _____

TITLE _____

DATE MAR 7 1983