

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.
30-025-24649

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
A-2614

7. Lease Name or Unit Agreement Name:
MCDONALD STATE WN

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☒ Other

2. Name of Operator

BP AMERICA

3. Address of Operator

P. O. BOX 1089 EUNICE NM 88231

8. Well No.

22

9. Pool name or Wildcat

JALMAT TANSIL UATES SRQ

4. Well Location

Unit Letter A : 990' feet from the NORTH line and 660' feet from the EAST line

Section 26

Township 22S

Range 36E

NMPM LEA

County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3474' RKB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

 
TD: 3600' PBTD: 3550' PERFS: 2938' - 3352' CSG: 4 1/2" - 9.5#

MIRUPU NDWH NU BOP LOAD HOLE AND TEST CSG TO 300# RU WIRE LINE RIH TAG CIBP @=2900' SPOT 35' CMT ON TOP CIBP POOH W/ WIRE LINE

PICK UP TBG RIH TO ABOVE CIBP AND DISPLACE HOLE W/ 9.5 # MUD PULL UP HOLE AND SPOT 25 SX CMT PLUG @ 2878' - 2978' 50' ABOVE TOP OF SALT. POOH W/ TBG. RU PERFORATORS AND PERF 50' BELOW TOP OF SHOE @ 400' RIH W/ TBG & PKR PUMP CMT 50' OUT AND 50' IN (50 SX CMT) WOC RIH AND TAG PLUG. PUH W/ TBG ND BOP SPOT 10 SX CMT, OR 60' TO SURFACE. CUT OFF WELLHEAD INSTALL DRY HOLE MARKER RDPU CLEAN LOCATIONS P&A WELL BORE

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE Workover Supervisor

DATE 2-4-03

Type or print name Jim Pierce

Telephone No.

(This space for State use) ORIGINAL SIGNED BY

GARY W. WINK

APPROVED BY OC FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of approval, if any:

DATE FEB 13 2003

WELLBORE SCHEMATIC

