

**ATTACHMENT TO FORM C-140  
COLLINS & WARE, INC.  
STATE PA No. 3**

- IV.** Workover procedure performed to abandon Drinkard producing zone 6470' - 6533' and re-complete in the Blinebry 5471' - 5975'.
- 1.) Set CIBP at 6400' plus 35' of cement.
  - 2.) Perforated L. Blinebry (5927' - 5975'), acidized with 1,000 gals 15% HCL.
  - 3.) Set retrievable bridge plug at 5887', perforated U. Blinebry (5471' - 5843'), acidized with 2,500 gals 15% HCL.
  - 4.) Pulled retrievable bridge plug, ran frac tubing and packer and fraced Blinebry (5471' - 5975') with 57,000 gals and 144,000# sand.
  - 5.) Pulled frac tubing and packer, ran production tubing, pump, and rods.
  - 6.) Put on production.