

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-7

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐  
Name of Operator  
Chevron U.S.A. Inc.  
Address of Operator  
P.O. Box 670 Hobbs, NM 88240  
Location of Well  
UNIT LETTER C 430 FEET FROM THE North LINE AND 1980 FEET FROM  
West LINE, SECTION 28 TOWNSHIP 22S RANGE 37E WMPM.

7. Unit Agreement Name  
8. Farm or Lease Name  
Manda B Tract C  
9. Well No.  
1  
10. Field and Pool, or Wildcat  
Drinkard/Tubb/Blaineby  
12. County  
Lea

15. Elevation (Show whether DF, RT, GR, etc.)  
3351

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

FORM REMEDIAL WORK ☐  
PERMANENTLY ABANDON ☐  
OR ALTER CASING ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER TA ☒

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Work performed 3-11-88 through 3-17-88

POOH w/rods and pump. ND WH, NU BOP. Attempt to rel TAC. Failed. RIH w/freepoint could not get past 875'. Pump 30bbl hot wtr dn tbg. POOH w/ prod. tbg. SIFN. PU pwr swivel, brk circ, PU grapple and TIH, tag at 2308'. Latch onto tbg. RU RYCO and ran free point 2956'. POOH, PU chem. cutter and TIH. Shot chem. cutter, cut tbg. PUH w/ cutter, cutter stuck, pull out of rope socket, left chem. cutter in hole. POOH w/ WS, drop tbg, PU OS w/ grapple, TIH, tag at 1964'. Latch onto fish and POOH w/ same. TIH w/ mill, tag at 2337. PU pwr swivel and est circ. w/CKF. Cut 3', POOH, rec two pieces of tbg. PU pwr swivel, est. circ. cut on fish and mill to 2836'. POOH w/ shoe, no recovery. GIH to 2815', break circ. attempt to estab inj rate at 1000psi, lost 750psi in 4 min. ND BOP, run 2 3/8" (2 jts) open ended to 76'. NU WH, RD MO PU. Well TA'd.

FOR 60 DAYS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

M. E. Abner TITLE Staff Drilling Engr.

DATE April 19, 1988

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT 1 SUPERVISOR

COPIES OF APPROVAL, IF ANY:

DATE