

NO. OF COPIES RECEIVED	
DISTRIBUTION	
AMT A FE	
ILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

3-NMOCD-Hobbs (Lea Co.)
1-R.J. Starrak-Tulsa
1-A.B. Cary-Midland
1-Engr.-PJB
1-File

50. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PERMISSION TO DRILL OR TO REOPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL OR TO REOPEN OR PLUG BACK FOR SUCH PROPOSALS.

OIL WELL ☒ GAS WELL ☐ OTHER-

Name of Operator
Getty Oil Company

Address of Operator
P.O. Box 730, Hobbs, New Mexico 88240

Location of Well
UNIT LETTER G 1880 FEET FROM THE North LINE AND 2090 FEET FROM
THE East LINE, SECTION 6 TOWNSHIP 22-S RANGE 37-E NMPM.

7. Unit Agreement Name
6. Farm or Lease Name
E.N. Grizzell
9. Well No.
2
10. Field and Pool, or Wildcat
Drinkard
12. County
Lea

15. Elevation (Show whether DF, RT, CR, etc.)
3458'

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up pulling unit and install BOP
2. Pull rods and tubing
3. GIH with retrievable BP and packer and locate casing leak
4. Set BP 100' below casing hole and dump sand on BP
5. Set packer at 100' above casing hole and squeeze off casing leak with approximately 100 sx. Class C cement
6. WOC.
7. Drill out cement to BP and test squeeze.
8. Pull BP
9. GIH with tubing and packer
10. Set packer at + 6475'.
11. Acidize perfs, 6558-6607' with 5,000 gallons 15% Hcl Acid and 65 ball sealers, flush with KCl water.
12. Pull tubing and packer
13. Run tubing and rods and return well to production
14. Observe results

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Dale R. Crockett TITLE Area Superintendent DATE 6/19/80
APPROVED BY [Signature] TITLE [Signature] DATE JUN 25 1980
CONDITIONS OF APPROVAL, IF ANY: