

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-26692
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 1091

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. Lease Name or Unit Agreement Name 002345 Ridge, 8006 JV-P
2. Name of Operator BTA Oil Producers	8. Well No. 1
3. Address of Operator 104 S. Pecos, Midland, TX 79701	9. Pool name or Wildcat 70360 Antelope Ridge (Atoka)
4. Well Location Unit Letter <u>J</u> : <u>1980</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>14</u> Township <u>23S</u> Range <u>34E</u> NMPM Lea County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3366' GR 3398' RKB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Notify NMOCD @ 505-393-6161, 24 hrs in advance

1. Set CIBP @ \pm 11990, Cap w/35' cmt
2. RIH w/tbg, spot plugs as follows & tag after spotting.
100' plug 1/2 in & 1/2 out - 7-5/8" liner @ 11289'
100' plug in 9-5/8" @ top of Bone Springs @ 8603'
100' plug in 9-5/8" @ 4950' (13-3/8" csg shoe)
100' plug in 9-5/8" @ 1400' @ Top Salt
3. Rig up on 9-5/8" csg, work pipe to recover (TOC @ 1374')
4. Spot 100' plug 1/2 in & 1/2 out csg stub.
5. Spot 100' plug @ 727'.
6. Spot 10' plug @ Surface, Cut wellhead, Install P & A marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dorothy Houghton TITLE Regulatory Administrator DATE 7-15-94
(915)
TYPE OR PRINT NAME Dorothy Houghton TELEPHONE NO. 682-3753

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE JUL 19 1994

CONDITIONS OF APPROVAL, IF ANY: