OIL CONSERVATION DIVISION P.O. Box 2088 Sint Pe, New Mexico 87504-2088 Sint Per Mexico 10 Colspan="2">Sint Pe, New Mexico 87504-2088 Sint Per Mexico 10 Colspan="2">Sint Pe, New Mexico 87504-2088 Sint Per Mexico 10 Colspan="2">Sint Pe, New Mexico 87504-2088 Sint Per Mexico 10 Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2">Colspan="2" Colspan= 200 Colspan= 200 <th colsp<="" th=""><th>Appropriate District Office</th><th>State of New Mexico Energy, Minerals and Natural Resources Department</th><th>Form C-103 Revised 1-1-89</th></th>	<th>Appropriate District Office</th> <th>State of New Mexico Energy, Minerals and Natural Resources Department</th> <th>Form C-103 Revised 1-1-89</th>	Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources Department	Form C-103 Revised 1-1-89
0: Drevel DD, Aduit, NM 82100 Commer DD, Aduit, NM 82100 Commer DD, Aduit, Aduit, State Commer DD, Aduit, Aduit, Aduit, State Commer DD, Aduit, Aduit,	ISTRICI'I	P.O. Box 2088		
STRICTUM: Mail Acade, NM 87410 6. State OR & Gauge Lases No. SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DAILL OR TO DEEPEN OR PLUG BACK TOA DEFERENT RESERVOR. USE "APPLICATION (FOR PERMIT (FORM C-10) FOR SUCH PROPOSALS) 7. Lase Name of Uait Agreement Name Type of Wail: omax Quay AQU State Numa of Operator 8. Well No. 1 Varies of Permits omax Quay AQU State Numa of Operator 8. Well No. 1 Varies of Permits On Towering 235 Rame of Wildest 105 South 4th St., Artesta, NM 88210 Und, North Bell Lake Wolfcam Wail Lear C: 660 Feet From The North 10 Towering 235 Rame of 326 NMPM Lea Sciola 10 Towering 235 Rame of 326 NMPM Lea Sciola 10 Towering 235 Rame of 326 NMPM Lea Common 10 Evel Mark OF, REM. M. CR. act SUBSEQUENT REPORT OF: SUBSEQUENT REPORT OF: SUBSEQUENT REPORT OF: 10 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: 10 Check Appropriate Box	ISTRICT II Santa Fe, New Mexico 87504-2088 O. Drawer DD, Artesia, NM 88210		5. Indicate Type of Lease STATE X FEE	
SUNDRY NOTICES AND REPORTS ON WELLS DO NOT USE THIS FORM FOR PROPOSALS TO DELLOR TO DEEPEN OF PLUG BACK TO A DEFENSIT RESPOND. USE "PROCESSALS TO DELLOR TO DEEPEN OF PLUG BACK TO A DEFENSIT RESPOND. USE "PROCESSALS TO DELLOR TO DEEPEN OF PLUG BACK TO A DEFENSIT RESPOND. USE "PROCESSALS TO DELLOR TO DEEPEN OF PLUG BACK TO A Type of Walk 7. Lase Name of Usit Agreement Name Type of Walk onum Quay AQU State Name of Openitor 1 1 Name of Openitor 8. Well No. 1 Name of Openitor 9. Pod same of Wilket 1 Usit Learn C. : 660 Feet From The North Usit Learn C. : 660 Feet From The North 1 Socian 10 Towenin 23S Rame 33E NMFM Lea Compo NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: SUBSEQUENT REPORT OF: SUBSEQUENT REPORT OF: REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS CCMMENCE DRULING OPNS. PLUG AND ABANDONMENT ALC ALTER CASING COMMENCE DRULING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Continue re-entry 1 Check Appropriate down and small amount of cement to 11159'. Fell out at 11159' Continue re-entry Continue re-entry 2 Deriofs Topol	STRICT III 00 Rio Brazos Rd., Aziec, NM 87410		6. State Oil & Gas Lease No.	
War	DO NOT USE THIS FORM FOR PF	ROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A		
Name of Opender YATES PETROLEUM CORPORATION 8. Well No. 105 South 4th St., Artesia, NM 88210 9. Pod same or Wilden Und. North Bell Lake Wolfcam Well Losside Und. North Bell Lake Wolfcam Well Losside 1 Ball Losside 1 Well Robit 1 Ball And Losside 1 Well Robit 1 Ball Continue Tepo			Quay AQU State	
Address of Operator 9. Pool amone or Wildcail 105 South 4th St., Artesia, NM 88210 Und. North Bell Lake Wolfcam Will Cosido Und. North Bell Lake Wolfcam Will Cosido 1980 Feet From The North Section 10 Townadip 235 Range 33E NMFM Lea County Section 10 Townadip 235 Range 33E NMFM Lea County 10 Townadip 235 Range 33E NMFM Lea County 10 Townadip 23S Range 33E NMFM Lea County 10 Exciso 10 Townadip 23S Range 31E NMFM Lea County 11 Electronic (Stow watch OP, RKB, RT, G.R., act) SUBSEQUENT REPORT OF: REMEDIAL WORK Altering CASING RFORM REMEDIAL WORK PLUG AND ABANDON CAMARENE DOILING OPNS. PLUG AND ABANDON Altering Continue re-entry Alter And TERE Casing Onther: Continue re-entry Cosing or Continue re-entry Continue re-entry 2 Decido Po	Name of Operator			
Address of Openator Und. North Bell Lake Wolfcam Weil Letter C:: 660 Feel From The North Line and 1980 Feel From The West L Section 10 Township 23S Range 33E NMPM Lea County More than 10 Township 23S Range 33E NMPM Lea County More than 10 Township 23S Range 33E NMPM Lea County More than 10 Township 23S Range 33E NMPM Lea County More than 10 Township 23S Range 33E NMPM Lea County More than 10 Township 23S Range 33E NMPM Lea County More than 2000 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: Repearation PLUG AND ABANDON REMEDIAL WORK Altering casing PLUG AND ABANDONMENT LLOR ALTER CASING PLUE AND ABANDON CHANGE PLLNS OTHER: Continue Te-entry County t		PRATION	9 Pool name or Wildcat	
Weil Lession Lise and 1980 Feet From The West L Sector 10 Township 235 Range 33E NMPM Lea County 10 Elevalor (Above Methike DF, RKB, RT, GR, etc.) 3590.6' CR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS Countent State	Address of Operator	tesia, NM 88210	Und. North Bell Lake Wolfcamp	
Section 10 Township 23S Range 33E NMPM Lea County 10 10. Elevation (Show whicher DF. REB. RT, GR. dc.) 3590.6' GR 3590.6' GR 10. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: RFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING WPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT LLOR ALTER CASING OTHER: Continue re-entry Continue re-entry 2 Decide Proposed or Completed Openations (Clearly used all perioses details, and give periosed date, including asimanel date of staring any proposed 2-14-97 Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel 2-14-97 Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel 2-14-97 Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel 2-14-97 Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel 2-14-97 Ran tubing. Casth fran to 11174'. <th>Well Location</th> <td></td> <td>· · · · · · · · · · · · · · · · · · ·</td>	Well Location		· · · · · · · · · · · · · · · · · · ·	
Sector 10 Itomation 10. Elevation (Show whether OF, RKB, M, GR, etc.) 3590.6' GR 3590.6' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: RFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING MPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT LLOR ALTER CASING CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT LOR ALTER CASING CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT Casing TEST AND CEMENT JOB OTHER: Continue re-entry Continue re-entry 2 Decribe Proposed or Completed Operations (Clearly state all perinees datali, and give perinees datalis, including atmixed data of starting any proposed work) SEE RULE 1103. 2-14-97 - Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel and tagged fish. POOH with 344 joints of 2-7/8" tubing. Trubing, broke off 1/4" inside bottom of tubing coupling. Left 5 joints tubing, 1 crossover, 10 4-3/4" drill collars and bit. NOTE: Have 2-7/8" upset looking for top of fish. Tor of fish at approx. 10757'. 2-15-97 - TIH with 5-1/2" OD skirted overshot to catch 2-7/8" tubing. Laid down 41 joi	Unit Letter : 66	0 Feet From The North Line and 19	80 Feet From The West Line	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: RFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING MPORARIL Y ABANDON CHANGE PLANS COMMENCE DRULING OPNS. PLUG AND ABANDONMENT ALL OR ALTER CASING CHANGE PLANS COMMENCE DRULING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: OTHER: Continue re-entry 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all perintent ducit, including estimated date of starting any proposed 2. Describe Proposed or Completed Operations (Clearly state all p	Section 10		NMPM Lea County	
EMPORABILY WORK Construction PLUG AND ADARDEX Construction PLUG AND ABANDON EMPORABILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CLL OR ALTER CASING CASING TEST AND CEMENT JOB CASING TEST AND CEMENT JOB PLUG AND ABANDONMENT CLL OR ALTER CASING OTHER: Continue re-entry Comment of the control of the		NTENTION TO: SUE		
CASING TEST AND CEMENT JOB CASING TEST AND CEMENT JOB OTHER:				
THER: OTHER: Continue re-entry 12 Describe Proposed or Completed Operations (Clearly state all perinent descit, and give perinent dates, including estimated date of starting any proposed work) SEE RULE 103. 2-14-97 - Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel and drilled rubber, cast iron and small amount of cement to 11159'. Fell out at 11159' Picked up 1 more joint and ran to 11174'. Lost 10 points weight. Ran tubing to 11194' and tagged fish. POOH with 344 joints of 2-7/8' tubing. Tubing broke off 1/4'' inside bottom of tubing coupling. Left 5 joints tubing, 1 crossover, 10 4-3/4'' drill collars and bit. NOTE: Have 2-7/8'' upset looking for top of fish. Top of fish at approx. 10757'. 2-15-97 - TIH with 5-1/2'' OD skirted overshot to catch 2-7/8'' tubing upset on 342 joints of 2-7/8'' tubing. Catch fish. POOH with 170 stands of tubing. Laid down 41 joints tubing. Waited on orders. Continued POOH with 20 stands. Laid down fish and break out overshot. Laid down 4'' drill collars. POOH. TIH with new 6-1/2'' bit, drill collars, crossover and 20 stands tubing. End of tubing. Rigged up swivel and drilled cast iron, rubber and small amount of cement from 11159-11161'. Lost Iberty cently that the Momenta above is traject complete to the best of up toowledge addelid. CONTINUED ON NEXT PAGE: MONATURE Matter And State Addelide Operations Technician Iberty cently that the Momenta above is traject complete to the best of up toowledge addelid. CONTINUED ON NEXT PAGE: MonATURE Matter Addelide Operations Technician The prove on the based of up toowledge addelid. CONTINUED ON NEXT PAGE: </td <th></th> <td></td> <td></td>				
11. Describe Proposed or Completed Operations (Clearly state all periment details, and give periment dates, including estimated date of starting any proposed work) SEE RULE 1103. 2-14-97 - Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel and drilled rubber, cast iron and small amount of cement to 11159'. Fell out at 11159' Picked up 1 more joint and ran to 11174'. Lost 10 points weight. Ran tubing to 11194' and tagged fish. POOH with 344 joints of 2-7/8" tubing. Tubing, broke off 1/4" inside bottom of tubing coupling. Left 5 joints tubing, 1 crossover, 10 4-3/4" drill collars and bit. NOTE: Have 2-7/8" upset looking for top of fish. Top of fish at approx. 10757'. 2-15-97 - TIH with 5-1/2" OD skirted overshot to catch 2-7/8" tubing upset on 342 joints of 2-7/8" tubing. Catch fish. POOH with 170 stands of tubing. Laid down 41 joints tubing. Waited on orders. Continued POOH with 20 stands. Laid down fish and break out overshot. Laid down 4" drill collars. POOH. TIH with new 6-1/2" bit, drill collars, crossover and 20 stands tubing. End of tubing at 1429'. 2-16-97 - Picked up 41 joints of tubing. TIH with rest of tubing. Rigged up swivel and drilled cast iron, rubber and small amount of cement from 11159-11161'. Lost Interview that Waitemation shows is true and complete to the best of up trowkidge and beid. CONTINUED ON NEXT PAGE: NONATURE Watty Mathematic Rusty Klein THE OPERATIONALE Note of State Use)	JLL OR ALTER CASING			
 work) SEE RULE 1103. 2-14-97 - Ran tubing from 9954-11154' (tag). Circulated bottoms up. Rigged up swivel and drilled rubber, cast iron and small amount of cement to 11159'. Fell out at 11159' Picked up 1 more joint and ran to 11174'. Lost 10 points weight. Ran tubing to 11194' and tagged fish. POOH with 344 joints of 2-7/8" tubing. Tubing broke off 1/4" inside bottom of tubing coupling. Left 5 joints tubing, 1 crossover, 10 4-3/4" drill collars and bit. NOTE: Have 2-7/8" upset looking for top of fish. Top of fish at approx. 10757'. 2-15-97 - TIH with 5-1/2" OD skirted overshot to catch 2-7/8" tubing upset on 342 joints of 2-7/8" tubing. Catch fish. POOH with 170 stands of tubing. Laid down 41 joints tubing. Waited on orders. Continued POOH with 20 stands. Laid down fish and break out overshot. Laid down 4" drill collars. POOH. TIH with new 6-1/2" bit, drill collars, crossover and 20 stands tubing. End of tubing. Rigged up swivel and drilled cast iron, rubber and small amount of cement from 11159-11161'. Lost Iberby cently the the Aformation above is true and complete to the best of my knowledge and belief. CONTINUED ON NEXT PAGE: MONATURE Rusty Klein THE Operations Technician March 6, 19 TOP FORMTINAME 		i i i Contini	1	
SKONATURE Kusty Klein THE Operations Technician DATE March 6, 19 TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/74 (This space for Sinks Use)				
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/74 (This space for State Use)	12. Describe Proposed or Completed Op work) SEE RULE 1103. 2-14-97 - Ran tubing and drilled rubber, Picked up 1 more joi and tagged fish. P(bottom of tubing cou and bit. NOTE: Hay 10757'. 2-15-97 - TIH with 5 joints of 2-7/8" tul joints tubing. Wai and break out oversi drill collars, cros 2-16-97 - Picked up and drilled cast in	erations (Clearly state all periment details, and give periment dates, inclu- g from 9954-11154' (tag). Circulated H cast iron and small amount of cement to int and ran to 11174'. Lost 10 points OOH with 344 joints of 2-7/8" tubing. upling. Left 5 joints tubing, 1 crosseve ve 2-7/8" upset looking for top of fish 5-1/2" OD skirted overshot to catch 2- bing. Catch fish. POOH with 170 stan ted on orders. Continued POOH with 20 hot. Laid down 4" drill collars. POO sover and 20 stands tubing. End of tu 41 joints of tubing. TIH with rest of con, rubber and small amount of cement	wing estimated date of starting any proposed bottoms up. Rigged up swivel to 11159'. Fell out at 11159'. weight. Ran tubing to 11194' Tubing broke off 1/4" inside over, 10 4-3/4" drill collars h. Top of fish at approx. 7/8" tubing upset on 342 ds of tubing. Laid down 41 stands. Laid down fish H. TIH with new 6-1/2" bit, bing at 1429'. f tubing. Rigged up swivel from 11159-11161'. Lost	
(This space for State Use)	12. Describe Proposed or Completed Op work) SEE RULE 1103. 2-14-97 - Ran tubing and drilled rubber, Picked up 1 more joi and tagged fish. PC bottom of tubing cou and bit. NOTE: Hay 10757'. 2-15-97 - TIH with 5 joints of 2-7/8" tul joints tubing. Wai and break out oversi drill collars, cros 2-16-97 - Picked up and drilled cast ir	erations (Clearly state all periment details, and give periment dates, inclu- g from 9954-11154' (tag). Circulated H cast iron and small amount of cement a int and ran to 11174'. Lost 10 points OOH with 344 joints of 2-7/8" tubing. upling. Left 5 joints tubing, 1 crosse ve 2-7/8" upset looking for top of fish 5-1/2" OD skirted overshot to catch 2- bing. Catch fish. POOH with 170 stan ted on orders. Continued POOH with 20 hot. Laid down 4" drill collars. POO sover and 20 stands tubing. End of tu 41 joints of tubing. TIH with rest o con, rubber and small amount of cement	wing estimated date of starting any proposed bottoms up. Rigged up swivel to 11159'. Fell out at 11159'. weight. Ran tubing to 11194' Tubing broke off 1/4" inside over, 10 4-3/4" drill collars h. Top of fish at approx. 7/8" tubing upset on 342 ds of tubing. Laid down 41 stands. Laid down fish H. TIH with new 6-1/2" bit, bing at 1429'. f tubing. Rigged up swivel from 11159-11161'. Lost	
(This space for State Use) OPAGINAL SIGNAL S	 12. Describe Proposed or Completed Opwork) SEE RULE 1103. 2-14-97 - Ran tubing and drilled rubber, Picked up 1 more join and tagged fish. P(bottom of tubing course and bit. NOTE: Have 10757'. 2-15-97 - TIH with Signification of 2-7/8" tuling ints of 2-7/8" tuling ints tubing. Wai and break out oversider drill collars, cross 2-16-97 - Picked up and drilled cast ir Ibereby certify that the information above in skonature. 	erations (Clearly state all periment details, and give periment dates, inclu- g from 9954-11154' (tag). Circulated H cast iron and small amount of cement a int and ran to 11174'. Lost 10 points OOH with 344 joints of 2-7/8" tubing. upling. Left 5 joints tubing, 1 crosse ve 2-7/8" upset looking for top of fish 5-1/2" OD skirted overshot to catch 2- bing. Catch fish. POOH with 170 stan ted on orders. Continued POOH with 20 hot. Laid down 4" drill collars. POO sover and 20 stands tubing. End of tu 41 joints of tubing. TIH with rest o on, rubber and small amount of cement internet complete to the best of my knowledge and belief. CONTINUE	wing estimated date of starting any proposed bottoms up. Rigged up swivel to 11159'. Fell out at 11159'. weight. Ran tubing to 11194' Tubing broke off 1/4" inside over, 10 4-3/4" drill collars h. Top of fish at approx. 7/8" tubing upset on 342 ds of tubing. Laid down 41 stands. Laid down fish H. TIH with new 6-1/2" bit, bing at 1429'. f tubing. Rigged up swivel from 11159-11161'. Lost D ON NEXT PAGE: Technician March 6, 1997	
	 12 Describe Proposed or Completed Opwork) SEE RULE 1103. 2-14-97 - Ran tubing and drilled rubber, Picked up 1 more join and tagged fish. PC bottom of tubing courand bit. NOTE: Hav 10757'. 2-15-97 - TIH with Signification of 2-7/8" tubility in tubing. Wai and break out oversiderill collars, cross 2-16-97 - Picked up and drilled cast ir I hereby certify that the Moremation above in SkonATURE	erations (Clearly state all periment details, and give periment dates, inclu- g from 9954-11154' (tag). Circulated H cast iron and small amount of cement a int and ran to 11174'. Lost 10 points OOH with 344 joints of 2-7/8" tubing. upling. Left 5 joints tubing, 1 crosse ve 2-7/8" upset looking for top of fish 5-1/2" OD skirted overshot to catch 2- bing. Catch fish. POOH with 170 stan ted on orders. Continued POOH with 20 hot. Laid down 4" drill collars. POO sover and 20 stands tubing. End of tu 41 joints of tubing. TIH with rest o on, rubber and small amount of cement internet complete to the best of my knowledge and belief. CONTINUE	wing estimated date of starting any proposed bottoms up. Rigged up swivel to 11159'. Fell out at 11159'. weight. Ran tubing to 11194' Tubing broke off 1/4" inside over, 10 4-3/4" drill collars h. Top of fish at approx. 7/8" tubing upset on 342 ds of tubing. Laid down 41 stands. Laid down fish H. TIH with new 6-1/2" bit, bing at 1429'. f tubing. Rigged up swivel from 11159-11161'. Lost	

•