ubmit 3 Copies Appropriate	State of New M Energy, Minerals and Natural F	lexico Resources Department	Form C-103 Revised 1-1-89
istrict Office ISTRICT I O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O. Box 2088		WELL API NO. 30-025-26766
DISTRICT II Santa Fe, New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410		5. Indicate Type of Lease STATE X FEE	
		6. State Oil & Gas Lesse No. V-3959	
SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name
Type of Well: OL GAS WEL X WELL	CT OTHER		Quay AQU State
Name of Operator			8. Well Na
YATES PETROLEUM CORI Address of Operator	PORATION	<u></u>	9. Pool name or Wildcat
105 South 4th St., A	Artesia, NM 88210		Und. North Bell Lake Wolfcamp
Well Location	660 Feet From The North	Line and 1	980 Feet From The West Line
		SUI	BSEQUENT REPORT OF:
ULL OR ALTER CASING		CASING TEST AND	
DTHER:		OTHER: Drill	plugs & squeeze perfs X
12 Describe Proposed or Completed		and the second s	
work) SEE RULE 1103. 2-1-97 - Continued	drilling hard cement f	rom 775-835'. N	ot making any hole. POOH with
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for night	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mest 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'.
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'.	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mes 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou ht. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949'	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. . Drilled cemen	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran at to 5037'. Circulated bottoms
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'. up. Shut down for	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mesh 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou nt. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949' r night.	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. Drilled cemer 6037-5175'. Ran 375-7130'. Ran	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran at to 5037'. Circulated bottoms tubing to 6875' and tagged fill. tubing to 7218' and circulated
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'. up. Shut down for 2-5-97 - Continued Rigged uppswivel.	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mesi 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou ht. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949' r night. d drilling cement from 58 Drilled cement from 68	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. Drilled cemer 037-5175'. Ran 375-7130'. Ran	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran it to 5037'. Circulated bottoms tubing to 6875' and tagged fill. tubing to 7218' and circulated NTINUED ON NEXT PAGE:
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'. up. Shut down for 2-5-97 - Continued Rigged uppswivel.	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mesi 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou ht. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949' r night. d drilling cement from 58 Drilled cement from 68	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. Drilled cemer 5037-5175'. Ran 375-7130'. Ran	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran at to 5037'. Circulated bottoms tubing to 6875' and tagged fill. tubing to 7218' and circulated NTINUED ON NEXT PAGE: Technician
work) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'. up. Shut down for 2-5-97 - Continued Rigged up swivel.	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mesl 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ou nt. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949' r night. d drilling cement from 55 Drilled cement from 68 we is true and complete to the best of my knowledge William	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. Drilled cemer 037-5175'. Ran 375-7130'. Ran	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran at to 5037'. Circulated bottoms tubing to 6875' and tagged fill. tubing to 7218' and circulated NTINUED ON NEXT PAGE: Technician DATE Feb. 17, 1997
word) SEE RULE 1103. 2-1-97 - Continued bit. 2-2-97 - TIH with TOOH. Had 6" X 6- 2-3-97 - Ran 6" X 836-840'. TOOH. cement in plug #2 Shut down for nigh 2-4-97 - TIH with Circulated bottoms tubing to 4935'. up. Shut down for 2-5-97 - Continued Rigged up swivel. I hereby certify that the information abov SKONATURE	drilling hard cement fr 6-1/2" blade bit. Made 3/4" smooth OD with mesh 6-3/4" OD shoe with wir Removed piece of metal. from 840-918'. Fell ount. bit to 3207'. Tagged f s up. Continued washing Tagged plug #3 at 4949' r night. d drilling cement from 55 Drilled cement from 68 we is true and complete to the best of my knowledge Wew Klein	rom 775-835'. N 1' in 1-1/2 hou h ID and 2 rows es and extension TIH with 6-1/2 t and ran tubing ill. Picked up down to 3839'. Drilled cemer 037-5175'. Ran 375-7130'. Ran	ot making any hole. POOH with rs. Getting metal in cuttings. of wire shores made. . TIH. Cut 4' core from " blade bit. Continued drilling to 940'. Circulated clean. swivel and washed down to 3523'. Circulated bottoms up. Ran at to 5037'. Circulated bottoms tubing to 6875' and tagged fill. tubing to 7218' and circulated NTINUED ON NEXT PAGE: