

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

140
SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NM 19620
2. NAME OF OPERATOR Upland Production Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P.O. Box 481, Midland, Tx. 79702		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FSL & 1980' FWL		8. FARM OR LEASE NAME Triste Draw Federal
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3728' GL	9. WELL NO. 1
		10. FIELD AND POOL, OR WILDCAT Diamondtail Bone Spring
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 11, T23S, R32E
		12. COUNTY OR PARISH Lea
		13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) _____	
(Other) _____		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Propose to plug and abandon the #1 TristeDraw Federal in the following manner:

1. Set CIBP at 9860' and cap with 35' cement. Seal off all Bone Spring perms from 9916' to 11,971'.
 2. Set a 150' cement plug from 8500' to 8650'. Top of Bone Spring @ 8511'.
 3. Set a 150' cement plug from 6925' to 7075'. Top of Brushy Canyon @ 7058'.
 4. Set a 100' cement plug from 4805' to 4905'. Top of Delaware @ 4954', base of 10 3/4" casing @ 4855'.
 - ⊗ 5. Set a 100' cement plug from 2800' to 2900'. 2000' above last plug. *Base salt*
 6. Set a 100' cement plug from 550' to 650'. Base of 16" casing @ 600'.
 7. Set a 50' cement plug from surface to 50', remove wellhead and install dry hole marker. (All open casing between plugs will be displaced with mud.)
 8. Clean up, plow and re-seed location and lease road.
- ⊗ 5a) 100' cmt plug 1200' to 1300' (Top salt)

18. I hereby certify that the foregoing is true and correct

SIGNED Michael Hedrick TITLE Vice Pres. DATE 8-21-86

(This space for Federal or State office use)

APPROVED BY [Signature] TITLE _____ DATE 9-2-86

CONDITIONS OF APPROVAL, IF ANY: