STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

	T	
DISTRIBUTION	1	
BANTA FE	1	
FILE		
U.S.O.S.		
LAND OFFICE		
OPERATOR	1	

OU CONSERVATION DIVISION

L	uo. or torico acceives	OIL CON.		DIVISION		Form C-10	
	DISTRIBUTION		P. O. BOX 2088			Revised	
	BANTA FE	SANTA F	E, NEW MEXI	CO 87501			•
Γ	FILE					5a. Indicate Type of Lease	
1	U.S.O.S.	1				· — ·	\mathbf{x}
ŀ	LAND OFFICE						لكا
	OPERATOR					5. State Oil & Gas Lease No.	
Ŀ		1					
						mmmmm	7777
	SUNDR	Y NOTICES AND REPO	ORTS ON WELLS		_	XIIIIIIIIIIII	/////
	(DO NOT USE THIS FORM FOR PRO- USE "APPLICATI	POSALS TO DRILL OR TO DEEPE ION FOR PERMIT - " (FORM C-1	O1) FOR SUCH PROPOS	(S.)	~.		7777.
1.						7. Unit Agreement Name	
•	14 F	OTHER-					
*	rece Wece L	OINEM-				8. Form or Lease Name	
	ne of Operator						
Ana	darko Production Co.					Lou Wortham	
3. Add	iress of Operator					9. Well No.	
ъ	O. Box 806 Eunice,	New Mexico 88231				19	
						10. Field and Pool, or Wildcat	
4. Loc	cation of Well	_				_	
	F 2	150 FEET FROM THE	orth	1980	FEET FROM	Eunice, SA South	
U	HIT LETTER	PEET FROM THE		AV	, , , , , , , , , , , , , , , , , , , ,		IIII
	Wort	11	225	37E			
*	West	н <u>11</u> Н То w н s н!	TED RA	NGE	NMPM.		/////
							7777.
777	mmmmm	15. Elevation (She	w whether DF, RT,	GR, etc.)		12. County	////
////			358.3			Lea	////
III		11111					7777
16.	Check A	Appropriate Box To In	dicate Nature o	f Notice, Repo	ort or Oth	er Data	
		• • •	1			REPORT OF:	
	NOTICE OF IN	TENTION TO:		3063	SEQUENT	REPORT OF.	
							_
	MM REMEDIAL WORK	PLUG AND AB	NDON REMEDIA	L WORK		ALTERING CASING	
			COMMEN	CE DRILLING OPHS.		PLUS AND ABANDONME	NT
TEMP	DRARILY ABANDON	•			H		
PULL !	OR ALTER CASING	CHANGE PLAN	CASING	PL THEMES ONA TEST	. Dorfo	rating Acidizing	ראו
	•		ОТНЕ	- Addictons	I Pello	rating, Acidizing	تا ــ
	we=						
	HER			and Frac			
12 D-	scribe Proposed or Completed Ope	erations (Clearly state all pe	rtinent details, and	ive pertinent dates	, including	estimated date of starting any pr	oposed
	WE SEE RULE 1 (03.	, , , , , , , , , , , , , , , , , , , ,		-			
	•						
1.	RUPU TOH w/ Product	ion String.					
	mru/ El II DED C DV	B Sat PRD @ 4300	o Dumped 2	SX sand on	top of	RBP. Set PKR @ 4270) ' .
2.			, . Dumpeu L	, 511 0 021 011	F		
	Tested to 3000# 0	. K.				4 =1 1 00 YOU	
3.	Unset PKR. Swabbed	csq. dry. Spotte	ed 500 gals c	f 15% NE-FE	acid &	4 Bbls 2% KCL Wtr.	
٠.	TOH. W/ PKR.						
_	RU Gearhart Co. Pe		31 w/ 2 TCDR	4151 - 551	w/2 JS	PF. 4231 - 38' W/	
4.	RU Gearhart Co. Pe	riorated 4104 - 0	W/ 2 USFF,	4101 00	, _ 0.	,	
	1 JSPF, (.40" Dia H	oles) Total of 2^{i}	holes. R.L	. Gearnart.		- 1 (20 (
5.	DII Western Co Aci	dized $w/1500$ gals	: 15% NE-FE <i>P</i>	cid w/ 30 ba	ıll seal	ers. Fraced w/ 28,0	000
٠.	gals of 65% Quality	form 580 071 SC	RN & 9800 c	als of 20% N	E-FE Ac	id w/ 30-7/8" ball	
	gais of 65% Quartey	10am, 500,0,1 be.				-	
	sealers.		0 1 00	7 12	04		
	TOH w/ PKR. TIH w/	Production string	g. POP @ 1:00	P.M. /-13-	04.		
6.	·		•				
6.							
6.	•						
6.	٠						
6.							
6.							
6.							
6.	·						
6.	·						
6.	•						
	neaby certify that the information a	bove is true and complete to	the best of my know	ledge and belief.			
	ereby certify that the information a	bove is true and complete to	the best of my know	ledge and belief.			
	ereby certify that the information a	bove is true and complete to				July 18, 198	 1
	ereby certify that the information a	bove is true and complete to	the best of my know			July 18, 198	1
	ereby certify that the information a	bove is true and complete to				_	1
	Howall Ix	chett.				_	1
	ORIGINAL SIGNED ST	JERRY SEXTON				_	