

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.

30-025-29469

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Lou Worthan

8. Well No.

19

9. Pool name or Wildcat

Wantz Abo

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

2. Name of Operator

Marathon Oil Company

3. Address of Operator

P.O. Box 2490 Hobbs, NM 88241

4. Well Location

Unit Letter **D** : **680** Feet From The **North** Line and **880** Feet From The **West** Line

Section **11** Township **22-S** Range **37-E** NMPM **Lea** County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

GL 3368 KB 3382

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: **Plug Back and Complete Blinebry** ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/16 MIRU pulling unit. ND wellhead. NU BOP. POOH w/tbg. RIH w/guage ring to PBTB. Dump 6 sx cmt (35') on CIBP at 7050'. RIH, set CIBP at 6500'. Dump 6 sxs cmt (35').

2/17 RIH w/pkr. Perf 5664-74', 5684-98', 5727-31', 5735-41', 5744-66', 5769-75', 4 SPF, 248 holes. POOH

2/18 RIH hydrotesting w/pkr. Set pkr at 5526'. Acidize 5664-5775' w/2000 gals 15% acid & 125 BS. Swab.

2/20 Rel pkr, reset at 5526'. Pump mini-frac using 12,000 gals 2% KCL wtr. Sand frac w/71,000 gals Delta frac w/162,000 lbs 16/30 sand & 39,000 lbs 16/30 Super LC sand. Flow well.

2/21 RIH, tag sand at 6276'. Rel pkr at 5526'. Clean out to 6342'. POOH w/bailer. RIH w/pkr, set at 5544'. Swab. Rel pkr, POOH. RIH w/pkr, set at 5544'. Run after frac logs from 6200-5200'. Swab.

2/25 Rel pkr at 5544'. POOH. RIH w/2 3/8" tbg. BOT 5827'. SN at 5795'. ND BOP. Set TAC at 5477'. NU wellhead.

2/27 RIH w/pump & rods. Load & test. OK. RD pulling unit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Kelly Cook

TITLE **Records Processor**

DATE **3/31/99**

TYPE OR PRINT NAME

Kelly Cook

TELEPHONE NO.

393-7106

(This space for State Use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: