

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
NM-058544

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Federal USA 'K' #1

9. API Well No.
30-025-30283

10. Field and Pool, or Exploratory Area
S. Brunson Drinkard Abo

11. County or Parish, State
Lea

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Texaco Exploration and Production Inc.

3. Address and Telephone No.

P.O. Box 730, Hobbs, NM 88240

(505)397-0428

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter N, 660' FSL & 1700' FWL
Sec 33, T-22-S, R-38-E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) MIRU. Pull rods and pump. Install BOP. Pull tubing.
- 2) By wireline, set CIBP above Drnk/Abo perfs @ 6450'.
- 3) By bailer, cap with 50' cement.
- 4) Circulate hole w/ 10 ppg salt gel mud w/ 25# gel per Bbl.
- 5) Spot 25 sx class 'C' plug from 4050'-3800'. WOC. Tag plug.
- 6) Spot 25 sx plug across casing shoe @ 1355' from 1450'-1200'. WOC. Tag plug.
- 7) Spot 50' cement plug at surface.
- 8) Cut off wellhead, install dry hole marker and clean location.

14. I hereby certify that the foregoing is true and correct

Signed R. McNaughton

Title Production Engineer

Date 10-04-93

(This space for Federal or State office use)

(ORIG. SGD.) JOE G. LARA

Approved by

Conditions of approval, if any:


Title Petroleum Engineer

Date 10/26/93


Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

TEXACO INC
FEDERAL (USA) "K" NO. 1
API# 30025302830000

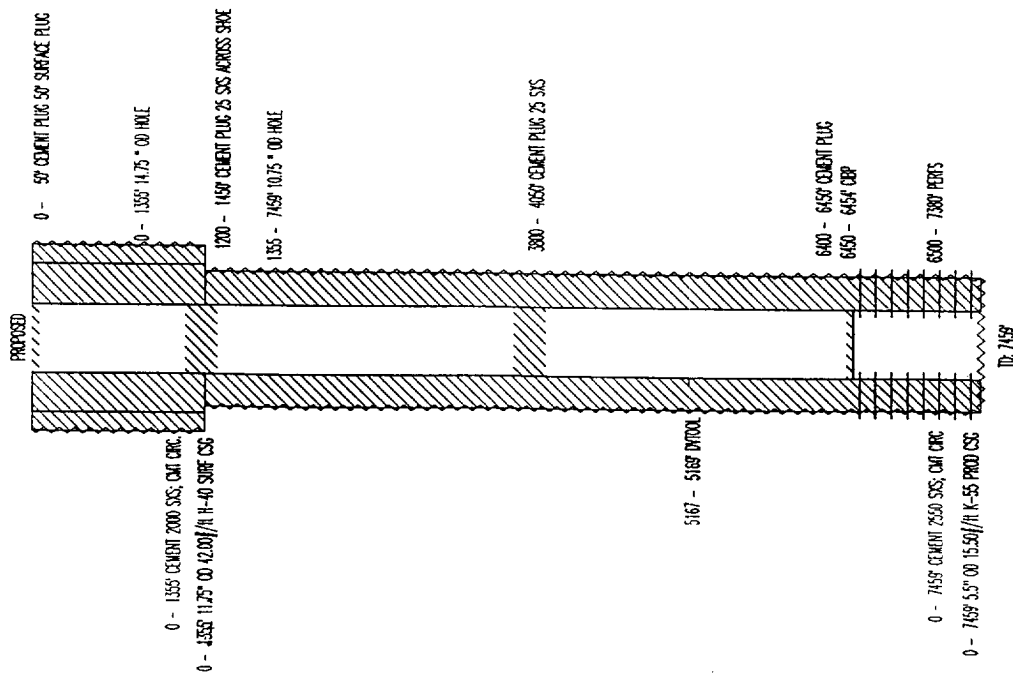

TEXACO INC
FEDERAL (USA) "K" NO. 1
API# 30025302830000

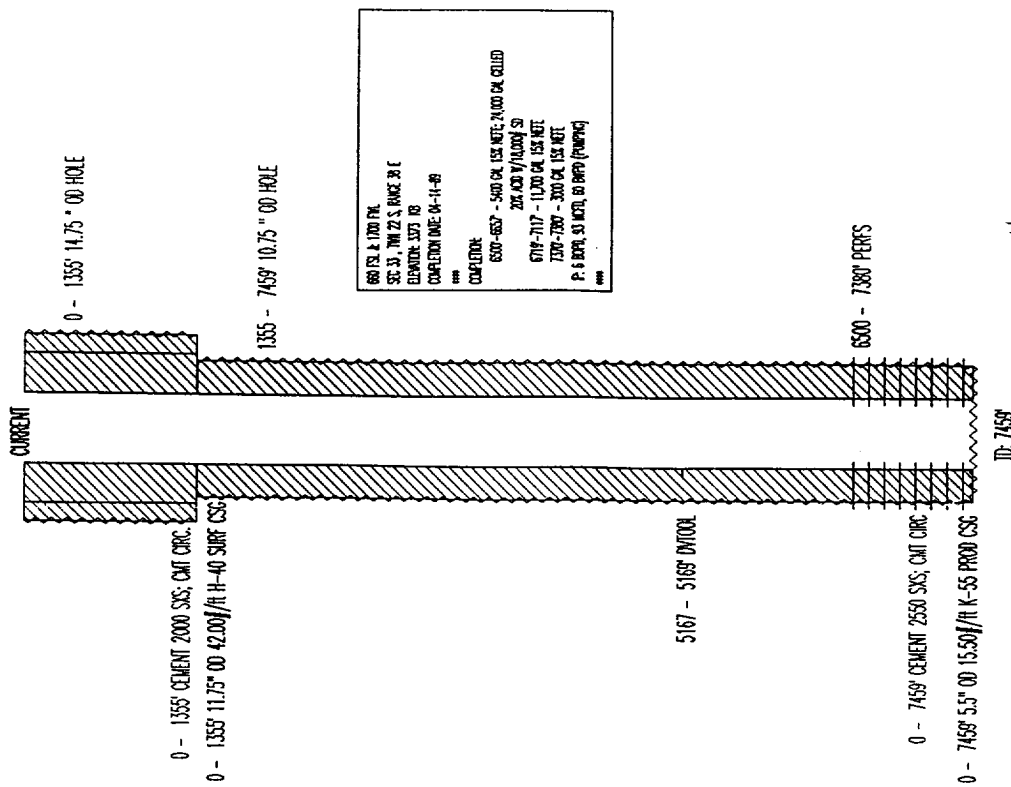

650' TO 1,170' FUL
SEC 33, TWP 22 S, RANGE 28 E
DEPARTMENT 3373 RD
COMPLETION NAME 04-11-#8

COMPLETION
6500-6503 - 540' OAL 155' METE 2100' OAL CEILID
205' OAL 155' METE
5167-7117 - 1,170' OAL 155' METE
7117-7380 - 300' OAL 155' METE
P. 6 DEPTH 51' METE 50' DEPTH (PUMPING)
