

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30025 34306
Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
State Oil & Gas Lease No.
Lease Name or Unit Agreement Name TOMCAT '16' STATE
Well No. 2
Pool name or Wildcat WILDCAT DELAWARE

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	
Name of Operator CONCHO RESOURCES INC.	
Address of Operator 110 W LOUISIANA STE 410; MIDLAND TX 79701	
Well Location Unit Letter M : 660 Feet From The SOUTH Line and 660 Feet From The WEST Line Section 16 Township 23S Range 32E NMPM LEA County	
Elevation (Show whether DF, RKB, RT, GR, etc.) 3679	

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ADD ADDITIONAL PAY ☒

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-29-99 MIRU PU. Pull rods & pump. RU WL. Perf 2 SPF 120 deg phase @ 8096-8104, 7403-7424' & 7196-7202'. RIH w/ RBP, RTTS, 2-7/8" SN & 2-7/8" tbg. Set RBP @ 8292'.
6-30-99 Set RTTS @ 7976'. Acidize w/ 1000 gals 7-1/2% NEFE HCL w/ 35 ball sealers. Rec 52 out of 79 BLTR. Last 8 bbls had approx 30% oil cut.
7-1-99 Made 1 swab run & rec 10 BO w/ 3% H2O. Frac zone w/ 10,500 gals gel & 26000# 16/30 Ottawa Sand & RC.
7-3-99 Made 3 swab runs & lowered FL to 4000'. Unset pkr & RIH. Tag sand @ 8065'. Rev sand out w/ 2% KCL to RBP @ 8292'. Latch & release RBP. PUH & reset RBP @ 7975'.
7-6-99 Set pkr to 7286'. Acidize w/ 2000 gals 7-1/2% NEFE HCL w/ 6 ball sealers to pkr.
7-7-99 Swab test 7403-7424'.
7-8-99 Reset RBP @ 7286'. Set pkr @ 7099'. Acidize w/ 1000 gals 7-1/2% NEFE HCL w/ 20 ball sealers.
7-9-99 Swab well. Latch RBP & POH w/ tbg & tools. RIH w/ tbg, pump & rods.
7-26-99 IP @ 114 BO, 100 BW, 102 MCF.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terri Stathem TITLE Production Analyst DATE 09-08-99
TYPE OR PRINT NAME Terri Stathem TELEPHONE NO. 915-683-7443

(This space for State Use)

APPROVED BY ORIGINAL SIGNED BY CHRIS WILLIAMS
DISTRICT I SUPERVISOR

TITLE _____ DATE 09 14 1999

CONDITIONS OF APPROVAL, IF ANY: