

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. LC-030139(A)
2. NAME OF OPERATOR CONOCO INC.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 460, Hobbs, N.M. 88240	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit D	8. FARM OR LEASE NAME Lynn A
	9. WELL NO. 2
	10. FIELD AND POOL, OR WILDCAT Jalmar Yates TRURS
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 27-235-36E
14. PERMIT NO. 30-025-09434	12. COUNTY OR PARISH Lea
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other:)

PULL OR ALTER CASING ☐
MULTIPLE COMPLETION ☒
ABANDON* ☐
CHANGE PLANS ☐

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other:)

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markets and zones pertinent to this work.)

- ① MIRU, scrape casing to 3000'. Set CIBP @ 2980'. Circ. hole full of 12.0ppg Mud. Spot a 145' on CIBP w/15sxs class "C".
- ② Spot 145' plug from 1555'-1700' (across top of salt section) w/15sxs class "C" w/2% CaCl₂.
- ③ Perf 5 1/2" CSG w/2JSF @ 70'. Circ. surface plug in place w/15sxs class "C" by circ. down 5 1/2" and up 7 5/8" annulus to surface.
- ④ Cut off wellhead and install P&A marker. Rig down.
- ⑤ A proposed P&A sketch is attached.

(2A) Perforate 5 1/2" casing at 1240 feet and spot 100 foot cement in 7 5/8" and 5 1/2" annulus and 100 foot plug in 5 1/2" casing.

(Per Ed Kepford and George Stewart 2-9-87)

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Administrative Supervisor

DATE 1-21-87

(This space for Federal or State office use)

APPROVED BY [Signature]

TITLE _____

DATE 2-9-87

CONDITIONS OF APPROVAL, IF ANY:

*See instructions on Reverse Side