

COPIES RECEIVED	
TRIBUTION	
FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- P&A	7. Unit Agreement Name
2. Name of Operator Atlantic Richfield Company	8. Farm or Lease Name W. B. Guthrie WN
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER O 660 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 34 TOWNSHIP 23S RANGE 36E NMPM.	10. Field and Pool, or Wildcat Jalmat-Yates
15. Elevation (Show whether DF, RT, GR, etc.) 3381' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well has been plugged and abandoned in the following manner:

Set 7" CIBP on WL @ 2928' & capped w/6 sx cmt.
Loaded hole w/heavy mud. Loaded hole w/salt gel mud containing 25 sx of gel/100 BW between plugs. Cut 7" csg @ 2689'. Unable to pull pipe. Cut 7" csg @ 2192'. Pulled 2192' of 7" 24# casing. Spotted 40 sk cmt plug from 1300-1400'. Cut 9-5/8" csg @ 262'. Pulled out of hole w/262' of 9-5/8" OD csg. Spotted 40 sk cmt plug 220-320'. Spotted 15 sk cmt plug from surface to 25'. Erected dry hole marker.

Well P&A 2/15/74.

Your office will be notified when location is ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>H. J. Rumsen</u>	TITLE <u>Dist. Dirg. Supv.</u>	DATE <u>2/22/74</u>
APPROVED BY <u>John W. Rumsen</u>	TITLE <u>2/22/74</u>	DATE <u>2/22/74</u>