| Office | State of New Mexico | Form C-1 |
|--|--|---|
| District ! | Energy, Minerals and Natural Resources | Revised March 25, 19 |
| 1625 N. French Dr., Hobbs. NM 88240 | | WELL API NO. |
| District II | OIL CONSERVATION DIVISION | 30-025-09507 |
| 811 South First, Artesia, NM 88210 District III | 2040 South Pacheco | 5. Indicate Type of Lease |
| 1000 Rio Brazos Rd., Aztec, NM 87410 | Santa Fe, NM 87505 | STATE X FEE |
| District IV 2040 South Pacheco, Santa Fe, NM 875 | • | 6. State Oil & Gas Lease No. |
| SUNDRY NO | OTICES AND REPORTS ON WELLS | 7. Lease Name or Unit Agreement Na |
| (DO NOT USE THIS FORM FOR PRO | POSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A | |
| PROPOSALS.) | PLICATION FOR PERMIT" (FORM C-101) FOR SUCH | Eugene Coats |
| 1. Type of Well: | _ | |
| Oil Well \(\(\text{\(\text{\) \exiting \exiting \exiting \text{\(\text{\(\text{\(\text{\) \exiting | Other | 8. Well No. |
| Name of Operator Texaco Explorati | on & Production, Inc. | 8. Well No. |
| 3 Address of Operator | | 9. Pool name or Wildcat Jalmat |
| P. O. Box 3109, | Midland, TX 79702 | Tansill Yates 7 Rvrs |
| 4. Well Location | | |
| Unit Letter M. | : 660 feet from the South line and | 660 feet from the West |
| OHIT Detter 11 | | |
| Section 3 | Township 24S Range 36E | NMPM Lea County |
| | 10. Elevation (Show whether DR, RKB, RT, GR, | etc.) |
| 11 (11 | k Appropriate Box to Indicate Nature of Notice | Report or Other Data |
| | | BSEQUENT REPORT OF: |
| PERFORM REMEDIAL WORK | | |
| 7 EM STAIN FREMESIAE FOR THE | | |
| TEMPORARILY ABANDON | CHANGE PLANS COMMENCE D | RILLING OPNS. PLUG AND ABANDONMENT |
| PULL OR ALTER CASING | MULTIPLE CASING TEST. | |
| · | COMPLETION CEMENT JOB | |
| OTHER: | OTHER: | |
| 12. Describe proposed or cor | npleted operations. (Clearly state all pertinent details, | and give pertinent dates, including estimated |
| | in appropriate the second of the second | |
| of starting any proposed we | ork). SEE RULE 1103. For Multiple Completions: Atta | ach wellbore diagram of proposed completion |
| of starting any proposed we or recompilation. | ork). SEE RULE 1103. For Multiple Completions: Att. | ach wellbore diagram of proposed completion |
| or recompilation. | | ach wellbore diagram of proposed completion |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl | 9 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s | ach wellbore diagram of proposed completion. .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl | 9 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 | ach wellbore diagram of proposed completion. .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' | .5# Brine w/25# gel P/BBI hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' | .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBI hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | .5# Brine w/25# gel P/BBI hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' | a 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" si Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completic .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' | 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" s Lug 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 | ach wellbore diagram of proposed completion. .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' | a 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" stag 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completion. 5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' I hereby certify that the information of the series | A 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" stag 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completic .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' | 1 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" sing 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry homeoneter to the best of my knowledge ation above is true and complete to the best of my knowledge ation above is true and complete to the best of my knowledge ation above is true and complete to the best of my knowledge ation above is true and complete to the best of my knowledge ation above is true and complete to the best of my knowledge at the large at th | sch wellbore diagram of proposed completice. .5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP @ 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' I hereby certify that the information of the series | A 3450'. Displace hole w/MLF, 9 Lug 3450'-3100' (Jalmat-9 5/8" stag 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completion. 5# Brine w/25# gel P/BBL hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' I hereby certify that the information of the series | a 3450'. Displace hole w/MLF, 9 lug 3450'-3100' (Jalmat-9 5/8" stag 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completion. 5# Brine w/25# gel P/BBI hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 dedge and belief. EESINENT DATE 3/29/ (915) Telephone No. 683- |
| or recompilation. 1. Set 7" CIBP 6 2. Spot 80 Sx pl 3. Spot 40 Sx pl 4. Perf 6 holes 5. Perf 6 holes 6. Circ Cmt 60' I hereby certify that the information of the second | a 3450'. Displace hole w/MLF, 9 lug 3450'-3100' (Jalmat-9 5/8" stag 2550'-2350' (B-Salt) Tag @ 2 @ 1500', Sqz 75 Sx 1500'-1200' @ 400', Sqz 125 Sx 400'-200' (1 to Surf w/15 Sx, Install dry ho | ach wellbore diagram of proposed completion. 5# Brine w/25# gel P/BBI hoe) Tag @ 2983' 305' (T-Salt) Tag @ 1165' 3 3/8" shoe) Tag @ 189' le marker. 3/29/01 |