State of New Mexico Submit 3 Copies Form C-103 Energy, Minerals and Natural Resources Department to Appropriate Revised 1-1-89 District Office OIL CONSERVATION DIVISION DISTRICT I WELL API NO. P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088 Santa Fe, New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM 88210 5. Indicate Type of Lease FEE X STATE DISTRICT III 1000 Rio Brazos Rd., Azzec, NM 87410 6. State Oil & Gas Lease No. SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) COOPER Type of Well: WELL X WELL OTHER 2. Name of Operator 8. Well No. MERIDIAN OIL INC. 5 3. Address of Operator 9. Pool name or Wildcat P.O. Box 51810, Midland, TX 79710-1810 JALMAT-TANSILL-YATES-7RVRS GAS 4. Well Location Unit Letter H : 1980 Feet From The NORTH 660 Feet From The EAST Line and Line thip 24-S Range 36-E

10. Elevation (Show whether DF, RKB, RT, GR, etc.) Township 24-S NMPM LEA County Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: X PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK **ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND ABANDONMEN **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. SEE PAGE 2 FOR PLUG AND ABANDONMENT PROCEDURE. I hereby certify that the information above is true and complete to the best of my knowledge and belief. PRODUCTION ASST. DATE 7-29-92

SIGNATURE AND MARIA L. PEREZ

TYPE OR PRINT NAME MARIA L. PEREZ

TYPE OR PRINT NAME MARIA L. PEREZ

TELEPHONE NO. 915-688-6906

TITLE

(This space for State Use)
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

AUG 0 3 '92

DATE

APPROVED BY CONDITIONS OF APPROVAL, IF ANY:

Cooper No. 5 Jalmat Field Lea County, New Mexico

Project Engineer: K. L. Midkiff Office: (915) 688-2868 Residence: (915) 520-4526

Plug and Abandonment Procedure

- 1. Notify NMOCD prior to starting work. MIRU PU. ND wellhead, NU BOP. POOH laying down production tubing. Pick up workstring and RIH with casing scraper to $\pm 2,915'$, POOH. Set cement retainer on tubing at $\pm 2,910'$. Squeeze open hole with 50 sxs of cement. Sting out of retainer and spot a cement plug across the base of the salt at 2,790' - 2,910' using 35 sxs of cement.
- 2. Pull up above plug and circulate hole with 9ppg gelled brine. Pull up to $\pm 1,365$ and spot a cement plug across the top of the salt at 1,245' -1.365'. Use 20 sxs of cement. POOH.
- 3. Perforate to four squeeze holes at 360'. Open braidenhead and establish circulation down casing. Pump 135 sxs of cement from surface allowing circulation out braidenhead. Do not displace. POOH laying down workstring. RD MO PU. Cut off casing 3' below ground level and install P&A marker. Clear, rip and reseed location.

Date: 22 July 82



