State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103

to Appropriate District Office	Like By, Million and Training 1990		MANIBOUT 7-7-45
OIL CONSERVATION DIVISION P.O. Box 1980, Hobbs, NM 88240 P.O. Drawer DD, Artesia, NM 88210 OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088		WELL API NO. 30-025-10686	
		5. Indicate Type of Lease STATE FEE	
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410		6. State Oil & Gas Lesse No.	
SUNDRY NOTICES AND REPORTS ON WELLS			
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name
Type of Well: OIL GAS WILL OTHER WSW		Skelly Peniose B Unit	
2. Name of Operator OXY USA Ir		16696	8. Well No.
3. Address of Operator P.O. Box 5	50250 Midland, TX 79	710-0250	9. Pool name or Wildows Vancy Lie Mattix 7R QGB
4. Well Location	80 Feet From The North	Line and 197	
G		_	NMPM Lea County
Section (Township 253 Ran 10. Elevation (Show whether L	OF, RKB, RT, GR, etc.)	
	Appropriate Box to Indicate N	Nature of Notice, R	
NOTICE OF IN	TENTION TO:	SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	
PULL OR ALTER CASING		CASING TEST AND CE	EMENT JOB
OTHER:		OTHER:	
12. Describe Proposed or Completed Oper work) SEE RULE 1103.	seixons (Clearly state at perturent details, and		ding estimated date of starting any proposed
SIGNATURE ///		belief. Regulatory	
David S	Stewart		TELEPHONE NO. 915685571

TYPE OR PRINT NAME

APPROVED BY ---

ORIGINAL SIGNES BY DAMS WILLIAMS POST FOR STATE OF SOR

David Stewart

_ DATE _

CONDITIONS OF APPROVAL, IF ANY:

ATTACHMENT C-103 OXY USA INC. SKELLY PENROSE B UNIT # 52 SEC 9 T238 R37E LEA COUNTY, NM

TD - 3654' PBTD - 3426' PERFS - 2886-2970'

MIRU PU 8/18/97, POOH W/ 33-3/4" ROD, PARTED. ND WH, NU BOP. POOH W/ 6 JTS 2-7/8", PARTED. FISH LEFT IN HOLE 70-3/4" RODS, PUMP, 80-2-7/8" TBG. RIH W/ OVERSHOT, STACKED OUT @ 416' ON SOMETHING SOFT, POOH, NO MARKS OR INDICATIONS ON SKIRT. RIH W/ COLLAR, WORK THRU TO 470', STACKED OUT AGAIN, POOH. RIH W/ IMPRESSION BLK, STACKED OUT @ 416', INDICATIONS ARE OF COLLAPSED CSG OR PIECE OF CSG SPLIT AND BENT OVER. RIH W. NOTCHED COLLAR TO 416', RU POWER SWIVEL CLEAN OUT TO 968', REC CMT SHALE (RED BED, IRON SULFIDE, NO METAL, POOH. RIH W/ OVERSHOT, GRAPPLE, TAG @ 422', CIRC DOWN TO 968', CAUGHT FISH, PULLED OFF NUMEROUS TIMES, POOH W/ 5jts 2-7/8" TBG AND 15" 3/4" RODS. RIH & WASH BRIDGES FROM 420-796', CIRC TO 1100'. TAG & WASH FROM 1110-1112', POOH REC 3' STUB. RIH W/ OS, GRAPPLE & MILL, WORK OVER FISH, PULL 27K, POOH W/ 32jts TBG. RIH W/ CLULOW SOCKET & WORK DOWN TO 2027', COULD NOT GET OVER FISH, ATTEMPT TO FISH, MILL FROM 8/25-8/28/97, WITHOUT SUCCESS.

8/29/97, CONTACT GARY WINK W/ NMOCD ABOUT A PLUGGING PROCEDURE, RECEIVED PERMISSION TO P&A. RIH W/ MULESHOE ON BENT JT TO 416', WORK 5hrs TO GET INSIDE PIPE, RIH TO 1800', TAG FILL. RU SWIVEL & CIRC TO 2027'. MIX & SPOT 70sx CL C CMT @ 2017', POOH TO 1497'. MIX & SPOT 70sx CL C CMT @ 1497', POOH TO 975'. MIX & SPOT 70sx CL C CMT @ 975', POOH TO 455', REV OUT 12SX CMT, POOH. RIH W/ CR & SET @ 358', EIR OF 1BPM @ 300#, M&P 50sx CL C CMT @ 1BPM @ 250#, STING OUT OF CR REV OUT, POOH, WOC. M&P 50sx CL C CMT SURF PLUG FROM 357', CIRC 13sx CMT TO PIT. RDPU 9/2/97, CUT OFF CSG & WH, INSTALL DRY HOLE MARKER.