

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
MONTICELLO, NEW MEXICO 88240

SUBMIT IN TRIPL
(Other instructions
reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER WATER INJECTION WELL		5. LEASE DESIGNATION AND SERIAL NO. NM-2244	
2. NAME OF OPERATOR Getty Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P.O. Box 730, Hobbs, N.M. 88240		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface Unit Letter P, 660' FSL & 660' FEL		8. FARM OR LEASE NAME Hughes Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3335' KB		10. FIELD AND POOL, OR WILDCAT Langlie Mattix	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 17-23S-37E	
		12. COUNTY OR PARISH Lea	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	<input type="checkbox"/>	PULL OR ALTER CASING	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	MULTIPLE COMPLETE	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	ABANDON*	<input checked="" type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>
(Other) PLUG AND ABANDON			

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	<input type="checkbox"/>	REPAIRING WELL	<input type="checkbox"/>
FRACTURE TREATMENT	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
SHOOTING OR ACIDIZING	<input type="checkbox"/>	ABANDONMENT*	<input type="checkbox"/>
(Other)			

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

1. Move in rig. Install BOP.
2. Pick up 2 3/8" workstring.
3. GIH with 4 1/2" CIBP on 2 3/8" workstring.
4. Set CIBP at + 3400'.
5. POH with workstring and setting tool.
6. GIH with 2 3/8" workstring open ended.
7. Tag CIBP, pull up and spot 3 sx. cement on plug, top of cement on plug + 3365'.
8. Pull workstring to + 2450'.
9. Spot 100 sx. cement plug in 4 1/2" casing from + 2450' to +940'.
10. Pull up and spot a 10 sx. cement plug at the surface from + 150' to surface.
11. POH and WOC.
12. Weld 1" steel plate over casing and install dry hole marker, P/A.

18. I hereby certify that the foregoing is true and correct

SIGNED

Dale R. Crockett

TITLE

Area Superintendent

DATE

4/30/84

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

APPROVED

TITLE

DATE

MAY 8 '84
P. R. Pittscheck
ACTING DISTRICT ENGINEER

0+6-BLM-Roswell 1-Engr. 1-
1-Midland- 1-Foreman

RECEIVED

MAY 9 1984

O.C.D.
HOBBS OFFICE