		NIT OF STA RTMEN'I OF TH REAU OF LAND MA	IE INTERIO		B° re- 5.	Form approved.  Budget Bureau No. 1004-0135  Expires August 31, 1985  5. LEASE DESIGNATION AND SERIAL NO.  LC-064118		
SUNDRY NOTICES AND REPORTS ON WELLS  (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  Use "APPLICATION FOR PERMIT—" for such proposals 17 1/11						6. IF INDIAN, ALLOTTEE OR TRIBE NAME		
OIL GAS OTHER			LIPR CT			7. UNIT AGREEMENT NAME		
3. ADDRESS OF O	etroleum Operatin	· · · ·	CANI. AREA			8. FARM OR LEASE NAME E. C. Hill 'B' Federal		
415 West	Wall, Suite 1000	, Midland, TX 79701			۷.	WELL NO.		
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*  See also space 17 below.)  At surface						10. FIELD AND POOL, OR WILDCAT		
Unit H, 1981' FNL &, 810' FEL						Teague (Paddock)  11. SEC. T. E. M., OR BLK. AND SEC 34, T23S, R37E		
14. PERMIT NO.	<del></del>		how whether or, R	T, CR, etc.)	12.	COUNTY OR PARISH	13. STATE	
		3273′ [				Lea	NM	
16.	Check	Appropriate Box T	o Indicate Na	ture of Notice, Report,	or Other	Data		
	NOTICE OF I	TENTION TO:		BO:	BREQUENT	EMPORT OF:		
TEST WATER	i—i	PCLL OR ALTER CASI		WATER SHUT-OFF		REPAIRING W	TELL	
FRACTURE TR	<del></del>	MULTIPLE COMPLETE		PRACTURE TREATMENT		ALTERING CA	<u> </u>	
REPAIR WELL		CHANGE PLANS		(Other) Recomp	letion	abandon men	X	
(Other)				(Note: Report re	ocinietion.	nitiple completion of Report and Log for	on Well	
PAGE 2 OF 4	work.) •		- Carlot	letalis, and give pertinent d as and measured and true v	ertical dep	the for all markers	and zones perti-	
<u>10-21-92</u>	SI. W.O.C.				<b>E</b>			
10-22-92	Unset pkr & POOH tbg & pkr. LD pkr & RIH w/6-1/8" mill tooth bit, bit sub @ 3872'. Drill to 4058'.							
<u>10-23-92</u>	Drill to 4317	". Tag pkr, circ h	ole, press to 1	1000 psi. Lost 40 psi 1	5 min. 1	OOH. Catch plug.	TOOH w/same.	
<u>10-24-92</u>	Perforate 1 :	SPF w/.33" holes FRC	M 5100′ - 5235	'. TIH w/179 jts w/bit	& scrape	r.		
<u>10-25-92</u>	MU BHA, TIH, acidize W/3600 gal 15% acid. Unset, reverse out, pull up to 5050' bottom pkr. Swab 4 runs. We trying to flow, well died. SWIFN.							
10-26-92	Swab back 156 psi. Held.	bbls total. TOOH was Run base log. Frac	w/pkrs, replace w/25000 gal GW	BOP. TIH w/Watson pkr + 31000# 16/30 OTAWA.	to 5024. Run temp	3', set, load cso log.	, press to 500	
18. I hereby certif	y that the foregoin	g is true and correct	Datro	oleum Engineer	<del></del>	1mmil 4	0 1003	
SIGNED						April I	.9, 1993	
(This space fo	r Federal or State	office use)						
APPROVED B	Y	F ANY:	TITLE			DATE		

\*See Instructions on Reverse Side