

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP
(Other instruction
verse side)

TE
re

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. <u>LC-030168B</u>
2. NAME OF OPERATOR <u>Conoco Inc.</u>	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR <u>P.O. Box 460 - Hobbs, New Mexico 88240</u>	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <u>660' FNL & 1980' FWL - Unit Letter C</u>	8. FARM OR LEASE NAME <u>Eaves B-1</u>
	9. WELL NO. <u>10</u>
	10. FIELD AND POOL, OR WILDCAT <u>Scarbrough Unit 7 Rm</u>
	11. SEC. T. R. M. OR S. & S. AND SURVEY OR AREA <u>31-26S-37E</u>
14. PERMIT NO. <u>30-025-21224</u>	12. COUNTY OR PARISH <u>Lea</u>
15. ELEVATIONS (Show whether DP, RT, GR, etc.)	13. STATE <u>NM</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRU. Run scraper to 2950'. G-IH w/CIBP, stopping at 1255'. P.O.H. Made several string mill runs. G-IH w/CIBP set at 2945'. Circ hole clean. Spot 23 sxs cement on top of CIBP. Tag plug at 2650'. Pull up to 1400' & spot 23 sxs cement. Tag plug at 1220'. Spot 15 sxs cement w/2% CaCl₂. Tag plug at 1220'. Spot 20 sxs cement. Tag plug at 1065'. Press test plug to 500 psi, held okay. Perf at 475' w/4 spf. Bullhead squeeze 140 sxs of cement & circulate to surface. Install P.D.A. marker on 5/27/83.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Administrative Supervisor

DATE Aug 19 11 53 AM '88

(This space for general or State office use)

APPROVED BY [Signature]

TITLE DIRECTOR, BLM

DATE 9-8-88

COPIATIONS OF APPROVAL, IF ANY:

*See instructions on Reverse Side

Under the Departmental Order, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM-Caswell (W) Area (2) Area (2) Caswell (2) Caswell (2)

E