

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Orig & 3cc: MM00C
lcc: File

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator GUNTER OIL COMPANY	8. Farm or Lease Name B. F. Davis
3. Address of Operator P. O. BOX 249, BOBBS, NEW MEXICO	9. Well No. 2
4. Location of Well UNIT LETTER I , 2310 FEET FROM THE South LINE AND 330 FEET FROM THE East LINE, SECTION 33 TOWNSHIP 23S RANGE 37E NMPM.	10. Field and Pool, or Wildcat Teague Blinbry
15. Elevation (Show whether DF, RT, GR, etc.) 3283 BP	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Well is producing excessive water, in an attempt to reduce water production we propose to plug off lower perforations as follows: (5707 - 5838) Set 5-1/2" 15.5# CIBP @ 5690; dump approximately 10' cement plug on top of BP. Swab test.

If above fails to reduce or shut off water, set 5-1/2" 15.5# CIBP @ 5570' (plug off perfs 5588-5666), dump approximately 10' cement on top of BP, run tubing, rods and pump.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED BY
HAROLD G. VEST

SIGNED _____ TITLE **Area Engineer**

DATE **3-10-69**

APPROVED BY **Leshie A. Clements**

TITLE _____

DATE **MAR 10 1969**

CONDITIONS OF APPROVAL, IF ANY: