

DEPARTMENT OF THE INTERIOR (Other Instructions on Reverse Side)  
BUREAU OF LAND MANAGEMENT

Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

5. LEASE DESIGNATION AND SERIAL NO.

LC - 062269 - A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

GRAHAM FEDERAL

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

DOUBLE X DELAWARE

11. SEC., T., R., M., OR BLK. AND SURVEY OR ALBA

Sec. 22-24S-32E

12. COUNTY OR PARISH

LEA

13. STATE

NEW MEXICO

1. OIL WELL ☒ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

RALPH E. WILLIAMSON

3. ADDRESS OF OPERATOR

P.O. BOX 16 MIDLAND, TEXAS 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*

See also space 17 below.)  
At surface

660' FSL & 1980' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3593 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETION

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON\*

SHOOTING OR ACIDIZING

ABANDONMENT\*

REPAIR WELL

CHANGE PLANS

(Other)

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- (1) Set CIBP @ 4850' and put 35' of cement on same.
- (2) Cut off or shoot off 4½ casing @ 4500' and pull same (estimated cement top).
- (3) Set 100' cement plug 50' in and out of 4½ stub.
- (4) Tag plug after plug has hardened enough to take weight.  
(reset plug if plug won't hold)
- (5) Set 100' cement plug from 2725-2825' to isolate salt, plug need not be tagged.
- (6) Set 100' cement plug from 980 to 1080' to isolate salt and T/Rustler @ 1040' (Do not tag plug).
- (7) Set 100' plug from 304-404' in and out of 8-5/8" casing set @ 3541'.
- (8) Tag plug after cement hardens (reset if plug won't hold).
- (9) Set 50' surface plug.
- (10) Erect dry hole marker.

\*\* See attached diagram.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Production

DATE

1-22-86

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

1-29-86

\*See Instructions on Reverse Side

RECEIVED

JAN 30 1986

HOODS OFFICE

RALPH E. WILLIAMSON

ONE FIRST CITY CENTER, SUITE 890


MIDLAND, TEXAS 79702

MAILING ADDRESS  
P. O. BOX 16

(915) 683-2200  
(915) 683-2633

RALPH E. WILLIAMSON  
GRAHAM FEDERAL #1  
660' FSL & 1980' FEL  
Sec. 22, T-24-S, R-32-E  
Lea County, New Mexico

Elevation 3593 GR  
3604 KB

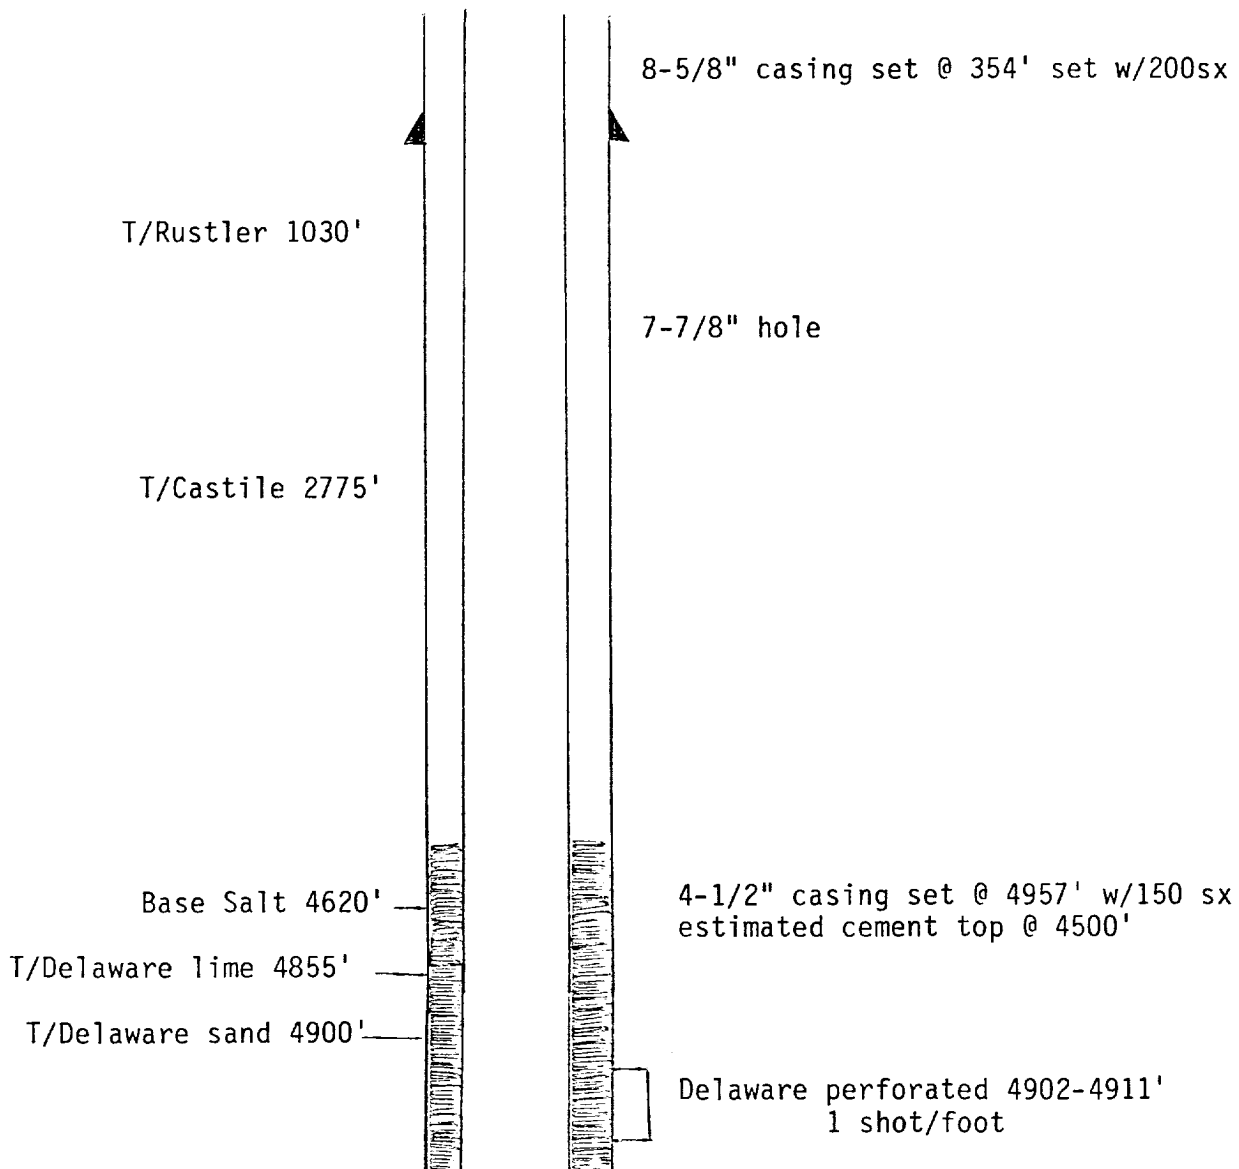

RECEIVED  
JAN 30 1986  
1000  
HOLDS SINCE