

Citgo LM State No. 2
Langlie Mattix Field
Lea County, New Mexico


Plug and Abandonment Procedure

Project Enginner: K. L. Midkiff

Office: (915) 688-6828
Residence: (915) 520-4526

1. Notify NM OCD prior to starting work. MIRU PU. ND wellhead, NU BOP. POOH with rods laying down. POOH with tubing. Make a casing scraper run to $\pm 3350'$, POOH. Set CIBP on tubing at 3325'. Cap CIBP with 50' of cement (5 sxs). Pull up above plug and circulate hole with 9 ppg gelled brine.
2. Pull up to 2825' and set a cement plug across the base of the salt at 2695' to 2825'. Use 10 sxs of cement. Pull up to 1440' and set a cement plug across the top of the salt at 1320' to 1440'. Use 10 sxs of cement. Pull up to 520' and circulate cement to surface using 40 sxs. POOH laying down tubing. Cut off casing 3' below ground level and install P&A marker. RDMO PU. Clear, rip, and reseed location.

NOTE: All cement will be Class C containing CaCl_2 .

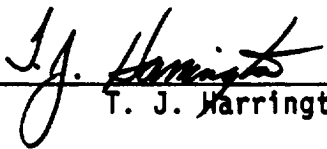Approved: 


T. J. Harrington

Date: 20 July 92




MERIDIAN OIL
CITGO LM STATE NO. 2
LANGUE MATTX FIELD
LEA COUNTY, NEW MEXICO

10 JUL 91 2:02

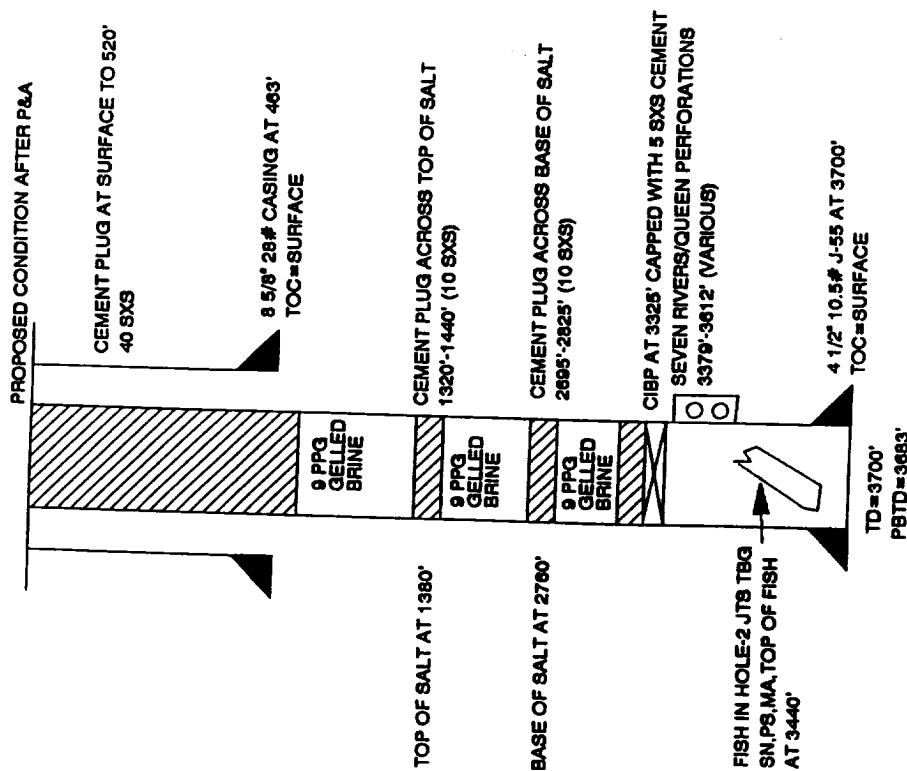

MERIDIAN OIL
CITGO LM STATE NO. 2
LANGUE MATTX FIELD
LEA COUNTY, NEW MEXICO

10 JUL 91 2:02

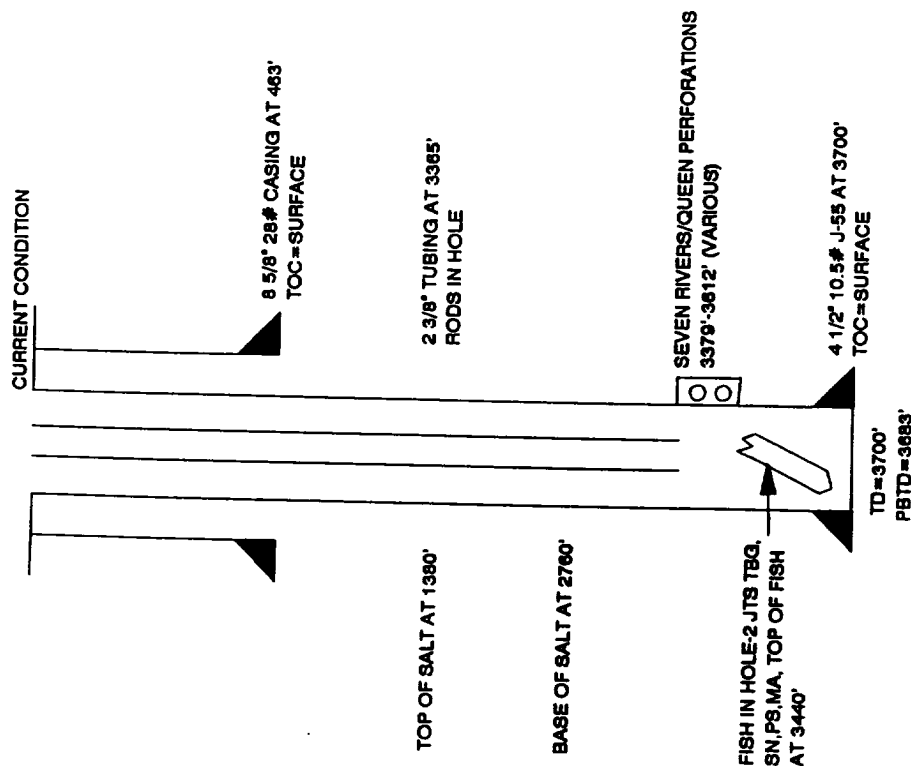

RECEIVED

JUL 30 1992

BOB HOBBS OFF