

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2086

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25672
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	B-9312
7. Lease Name or Unit Agreement Name	MEXICO -L-
8. Well No.	26
9. Pool Name or Wildcat	DOLLARHIDE FUSSELMAN
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	PO BOX 3109, MIDLAND, TEXAS 79701
4. Well Location	Unit Letter <u>D</u> : <u>566</u> Feet From The <u>NORTH</u> Line and <u>860</u> Feet From The <u>WEST</u> Line Section <u>5</u> Township <u>25S</u> Range <u>38E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
 TEMPORARILY ABANDON ☒ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐
 OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILL OPERATIONS ☐ PLUG AND ABANDONMENT ☐
 CASING TEST AND CEMENT JOB ☐
 OTHER: ☐ Request TA status ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Texaco E & P respectfully request permission to temporary abandon the subject well. Engineering staff is currently evaluating this well for horizontal reentry.

6/20/01 MI RU PU Key Energy Louis Anaya. Pull and lay down rods and pump. Release TAC TOH with tubing. TIH with 5.5" casing scraper to 8324' SIFN.
 6/21/01 POH with casing scraper RU WL TIH and set CIBP @ 8124' Load casing and pressure test to 550 psi for 30 min and chart. (Held OK) dump 35' cement on top of plug NEW PBTD 8089'. TIH with tubing to 8120'. SIFN
 6/22/01 Circ. Hole with packer fluid called Buddy Hill with NMOCD @ 369-6234 to witness test. (He was unable to make it to location but instructed Louis to proceed with casing test) Rig up kill truck, load and pressure test casing to 550 psi (HELD OK) MU up well head left PU rigged up will rig down Monday am. SEE CHART ATTACHED.


This Approval of Temporary
Abandonment Expires 6/27/06

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M. Quintana TITLE Engineering Assistant DATE 6/25/01
 TYPE OR PRINT NAME Mike Quintana Telephone No. 505-394-9307

(This space for State Use)

APPROVED BY _____ TITLE _____ ORIGINAL FILED BY _____ DATE _____
 CONDITIONS OF APPROVAL, IF ANY: _____ FIELD NO. _____

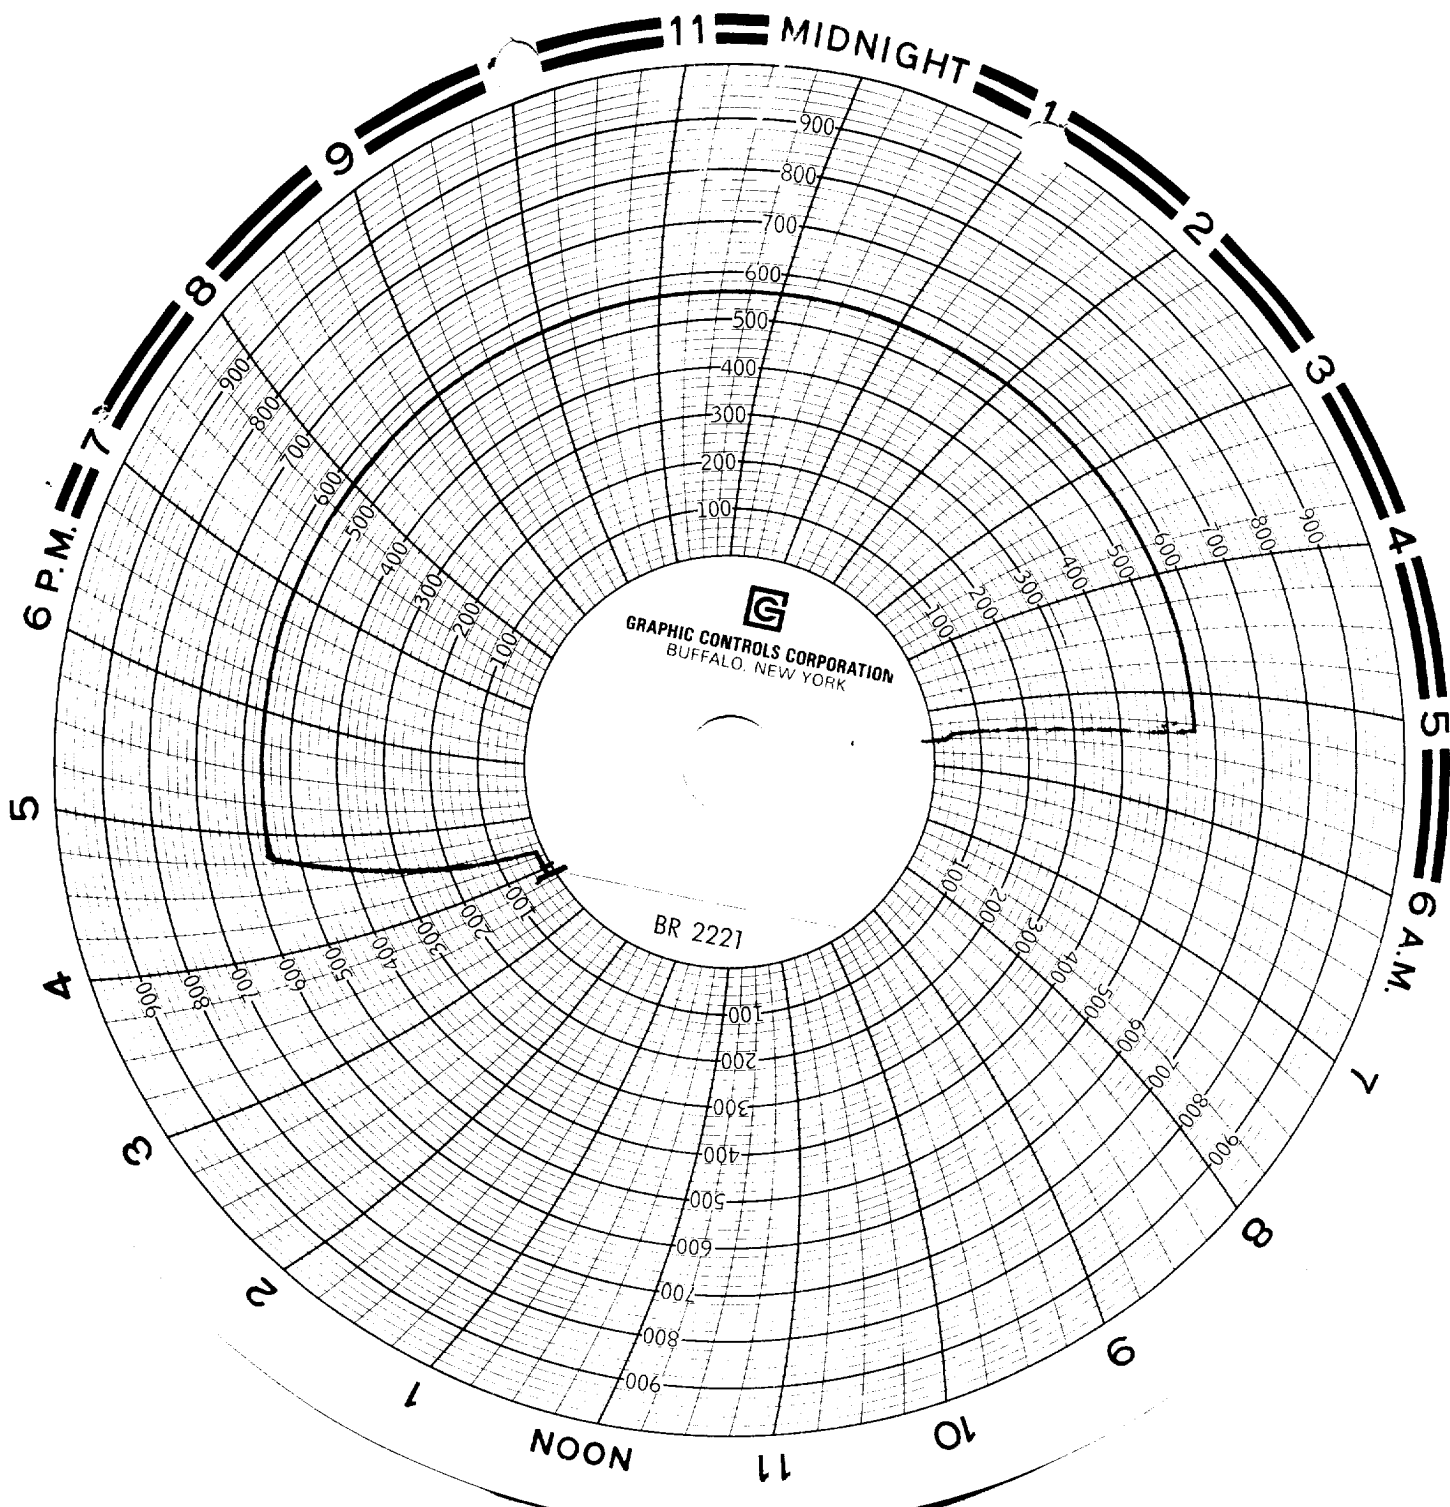

6/22/01
TEXACO EXPLORATION
7:00 PM
EXPLORATION + PROSPECTION INC
MEXICO, D.F. #26
ARB TRANS UNIT #25
Ducard [Signature]

