


Ralph E. Williamson
Conoco Federal "26" #1
Lea County, NM
NM84897

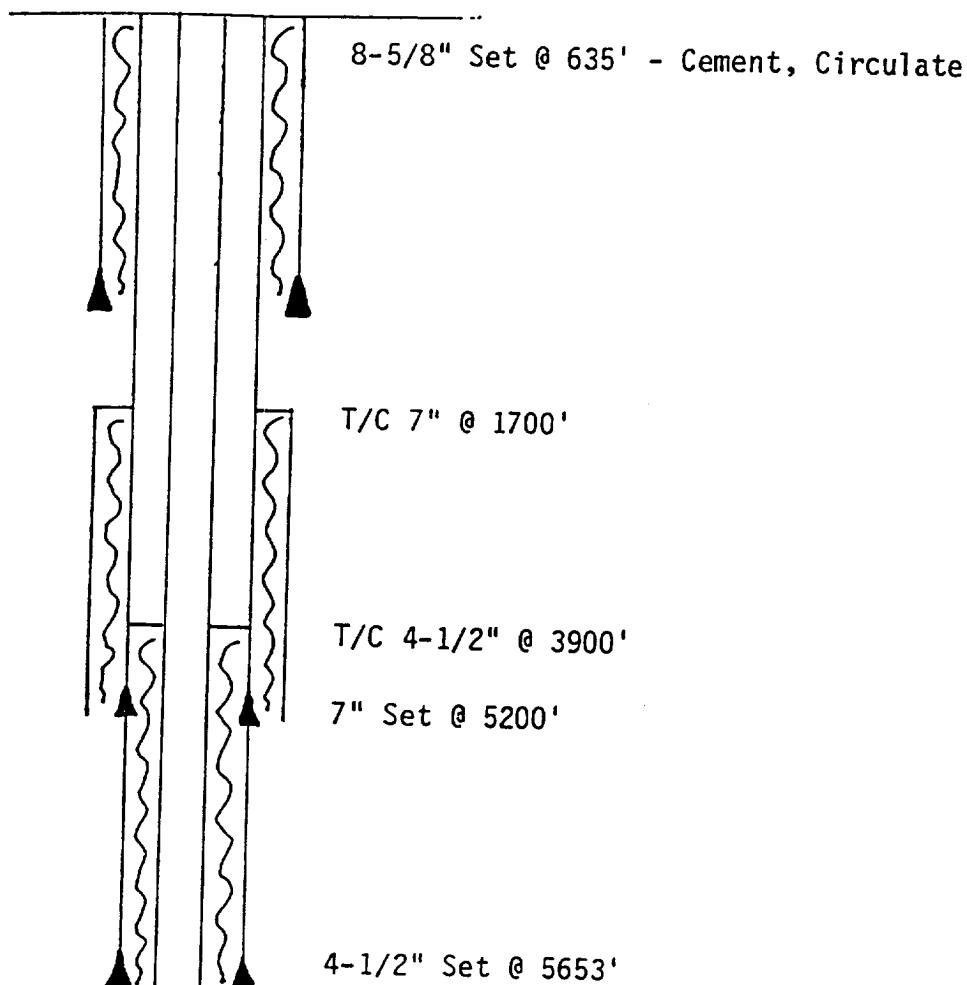

- (1) Pull downhole pump and rods, lay down same.
- (2) Pull tubing, stand in derrick.
- (3) Set CIBP w/wireline @ 5171'.
- (4) Put 35' cement on top of CIBP.
- (5) Cut and pull 4-1/2" casing @ 3500±, lay down casing.
- (6) Set 100' cement plug from 3450' - 3550', tag cement when hard.
- (7) Cut and pull 7" casing @ 1500', lay down casing. 1530'
- (8) Set 100' cement plug from 1450' - 1500', tag cement when hard.
- (9) Set 100' cement plug from 585' - 685', tag cement when hard.
- (10) Set 50' surface plug.
- (11) Cut of well head.
- (12) Clean location, remediate location as per instructions after equipment is removed from the lease.