

L CONSERVATION DIVISION
P. O. BOX 2068
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Disposal Well	7. Unit Agreement Name
2. Name of Operator Chaparral Service, Inc.	8. Farm or Lease Name Lea
3. Address of Operator P. O. Box 1768, Eunice, NM 88231	9. Well No. #1
4. Location of Well UNIT LETTER <u>B</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>1650</u> FEET FROM THE <u>East</u> LINE, SECTION <u>17</u> TOWNSHIP <u>23S</u> RANGE <u>37#</u> NMPM.	10. Field and Pool, or Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 3327	12. County Lea

10. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Moved in and rigged up.
Drill out cement plugs @ surface to 190' - plug @ 1122' to 2600'.
Drill out CIBP @ 2660'.
Squeeze perf. @ 2709' to 3247'.
W.O.C. 24 hours.
Drill out cement to 3247'.
Test casing to 500# for 30 min.
Drill out CIBP @ 3463'.
Run bit to 5050'.
Set CIBP @ 5050'.
Perforated casing 5 1/2" @ selected intervals @ 4125' to 4699'.
Acidize perf.
Ran 2 7/8 coated tubing and packer to 4100', set packer.
Load back side with treated water.
Rig Down

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Eddie W. Seay TITLE Owner DATE 12/2/85

APPROVED BY Eddie W. Seay TITLE Oil & Gas Inspector DATE DEC 10 1985

CONDITIONS OF APPROVAL, IF ANY:

✓

RECEIVED
DEC 9 - 1985
C.C.O.
HOBBS OFFICE

RECEIVED
DEC 8 - 1985
C.C.O.
HOBBS OFFICE