

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

30-1000-10-1-1
SUBMIT IN TRIPLICATE
COPIES INSTRUCTIONS
VERSE SIDE

LEASE DENOMINATION AND SERIAL
10 NM-14160
6 IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Pogo Producing Company	8. FARM OR LEASE NAME Mosbacher 20
3. ADDRESS OF OPERATOR P. O. Box 10340, Midland, Texas 79702	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FSL & 1980' FWL	10. FIELD AND POOL OR WILDCAT Bradley wellcamp
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.)
12. COUNTY OR PARISH Lea	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON*

SHOOTING OR ACIDIZING

ABANDONMENT*

REPAIR WELL

CHANGE PLANS

(Other)

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 12/29/86 Remove wellhead, install BOP. Ran WL 2 7/8" jet tbq cutter. Cut 2 7/8" tbq @ 13,262' POH WL, pump 100 BBLs 10# BW + 37 BBLs 10# BW mud. Carr spotted 15 sxs cmt plug @ 13,262' to 13,203'. Approved by the BLM-Hobbs. POH 20 jts 2 7/8". Reversed out w/10# BW, no cmt returns. SI well-WOC.
- 12/30/86 Circ 40 BBLs down tbq & POH tbq. Recovered 393 jts 2 7/8" + 22' cut off jt + 1 jt 3 1/2" tbq + 4-3 1/2" subs. RIH 9 5/8" CI bridge plug w/131 jts tbq.
- 12/31/86 Circ 30 BBLs 10# BW, RIH 9 5/8" CIBP & set @ 12,450'. Disp to 10# mud. Spotted 20 sxs cmt 12,450-12,400'. POH to 9400'.
- 1/01/87 Spotted 55 sxs cmt 9400'-9250'. POH tbq & LD 194 jts.
- 1/02/87 RD BOPs. Weld on 9 5/8" jt, installed csg jacks, removed slips. Ran jet cutter & cut 9 5/8" casing @ 6632'. Csg jumped free.
- 1/03/87 Align jacks. POH & LD 152 jts 9 5/8" csg + 1 cut-off jt.
- 1/04/87 RIH tbq OE to 6707'. Spotted 85 sxs cmt 6707'-6557'. WOC 3 hrs & tagged plug w/WL @ 6557'. POH to 5393'. Spotted 115 sxs cmt from 5393'-5243'. SD.
- 1/05/87 Tagged plug @ 5317'. Spotted 60 sxs cmt 5317'-5225'. WOC 3 hrs and tagged plug @ 5227'. POH to 2243', spotted 75 sxs cmt from 2243' to 2143'. POH to 952', spotted 75 sxs cmt 952' to 852'. SD.

CONTINUED ON NEXT PAGE

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE

Petroleum Engineer

DATE

January 14, 1987

(This space for Federal or State office use)

APPROVED BY

[Signature]

TITLE

DATE

1-28-87

CONDITIONS OF APPROVAL, IF ANY:

Approved by _____
and _____
and _____
surface operations is completed.

*See Instructions on Reverse Side

RECEIVED
JAN 30 1987
OCD
HOBBS OFFICE