Submit 3 Copies to Appropriate District Office

## State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT: PO. Bax 1980, Hobba, NM 82240  FO. Bax 1980, Johnson, NM 82240  Santa Fe, New Mexico 87504-2088  Sunda Cha Lease No.  SUNDRY NOTICES AND REPORTS ON WELLS  (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEFEREN OR PLUG AND ADMINISTRATE OF THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG AND ADMINISTRATE OF THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG AND ADMINISTRATE OF THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG AND ADMINISTRATE OR THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO DEFEREN OR PLUG BACK TO A THE PROPOSALS TO DRILL OR TO THE PROPOSALS T		
SETRICT   Sc. Drawer DD, Anteria, NM 82210   Santa Fe, New Mexico 87504-2088   S. Indicato Type of Lase STATE   FE   STATE   STATE   FE   STATE   FE   STATE   STATE   STATE   FE   STATE   ST		"EEE /EI NO.
DISTRICT III  (CO NOT USE THIS FORM FOR PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (CO NOT USE THIS FORM FOR PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (DEPERENT RESERVOR. USE PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO DEEPEN OR PLUG BACK TO A  (PORM C-101) FOR BLOF PROPOSALS TO BE A  (PORM C-101) FOR BLOF PROPOSALS  (PORM C-101) FOR BACK TO BET BACK TO BETA BACK TO A  (PORM C-101) FOR BACK TO BETA BACK TO BETA BACK TO BETA BACK TO BACK TO BETA BACK TO BETA BACK TO BACK TO BACK	DISTRICT II Santa Fe. New Mexico 8	7504-2088
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUS PROPIED TO PREMITY   TO DEEPEN OR DESERVOR USE "APPLICATION FOR PERMITY (FORM 0-101) FOR SUCH PROPOSALS.)   1. Type of Wall:		
Call IX will IX will Greated TEXACO EXPLORATION AND PRODUCTION INC.  3. Address of Operator P. O. Box 3109 Middand, Texas 79702  Will Lossido Usis Letter D : 5.10 Feet From The NORTH Lise and 660 Feet From The WEST Lise Section 9 Township 23—SOUTH Range 37—EAST NMPM LEA  Township 23—SOUTH Range 37—EAST NMPM LEA  County 10. Elevation (Shore whether DF, RRB, RT, GR, etc.)  Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS  COMMENCE DRILLING OPNS. PLUG AND ABANDONNENT PULL OR ALTER CASING  OTHER:  OTHER:  OTHER:  OTHER:  OTHER COMPLETION  I. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000 FOR 30 MINUTES 06–07–93.  JOWIEL ADDITION THIS BOX ALD 155 KHC. 06–08–33. SWAB 51 BO IN 11 HRS. 06–09–93.  3. DOWNELL ADDITION THIS BOX CALL SHE KHC. 06–08–33. SWAB 51 BO IN 11 HRS. 06–09–93.  5. SET RIPP @ \$230'. TEST RIPP TO 3000 F. PERFED W/ 2 JSPF: 5174' – 5191'. 36 HOLES.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–08–33. SWAB 51 BO IN 11 HRS. 06–09–93.  5. SET RIPP @ \$200'. TEST RIPP TO 3000 F. PERFED W/ 2 JSPF: 5174' – 5191'. 36 HOLES.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–10-13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–10-13-33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–11–33. SWAB 55 BO IN 5 HRS. 06–11–93.  5. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–11–13.  6. SET RIPP @ \$130'. TEST RIPP TO 3000 F. PERFED W/ 2 JSPF: 5108' – 5124'. 34 HOLES.  7. DOWNEL ADDITION THIS BOX CALL SHE KHC. 06–11–13.  10. TESTING  THE DEPRIS HAME COVER THE BOX CALL	(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN O DIFFERENT RESERVOIR. USE "APPLICATION FOR PERM (FORM C-101) FOR SUCH PROPOSALS.)	R PLUG BACK TO A  7. Lease Name or Unit Agreement Name
TEXACO EXPLORATION AND PRODUCTION INC.  P. O. BOX 3109  Midland, Texas 79702  WINDESIGNATED (WILDCAT)  Lise and 660 Feet From The WEST Lise  Lise Letter D : 510 Feet From The NORTH Lise and 660 Feet From The WEST Lise  Section 9 Township 23—SOUTH Range 37—EAST NMFM LEA  County  10. Elevation (Show whather OP, RKS, RT, GR, etc.)  Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data  NOTICE OF INTENTION TO:  SUBSEQUENT REPORT OF:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING  TEMPORARILY ABANDON CHANGE PLANS CASING TO SUBSEQUENT REPORT OF:  PULL OR ALTER CASING CHANGE PLANS CASING TO SUBSEQUENT REPORT OF:  PULL OR ALTER CASING TEST AND CEMENT JOB THE COMMENCE DRILLING OPNS. PLUG AND ABANDONIMENT CASING TEST AND CEMENT JOB THE COMMENCE DRILLING OPNS.  1. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06–07–93.  2. UNION RAM GR-CCL. PERFED W/ 2 JSPF: 5286' - 5286'. 42 HOLES.  3. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06–08–93. SWAB FOR SET RIP P @ 5230'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5174' - 5191'. 36 HOLES.  5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06–19-33. SWAB SES ON 15 HRS. 06–11–93.  8. SET RIPB @ 6136'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5108' - 5124'. 34 HOLES.  7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06–19-33. SWAB SES ON 15 HRS. 06–11–93.  8. TOH WITH RBP. THE WITH 2 7/8 TUBING, RODS AND PUMP.  9. PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS. 06–17–93.  1 hereby contry that the information showing in true and complete to the best of my knowledge and boild.  1 Hours pace for State Use) CRIGINAL SIGNED BY 200 ACID ACID.  Chair pace for State Use) CRIGINAL SIGNED BY 200 ACID ACID.  TITLE DRIPLING OPERATIONS MANAGER  DATE 06–21–93  TITLE DRIPLING OF STATE OF THE DRIPLING OPERATIONS MANAGER  TO STATE OF THE DRIPLING OPERATIONS MANAGE	044	
P. O. BOX 3109 Midland, Texas 79702  Well Lester D : 510 Feet Prom The NORTH Line and 660 Feet Prom The WEST Line Unit Letter D : 510 Feet Prom The NORTH Line and 660 Feet Prom The WEST Line Section 9 Township 23—SOUTH Range 37—EAST NMPM LEA    Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data   NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:   PERFORM REMEDIAL WORK		
Unil Letter D : 510 Feet From The NORTH Line and 660 Feet From The WEST Line  Section 9 Township 23-SOUTH Range 37-EAST NMPM LEA  County  10. Elevation (Norw whether DF, RKB, RT, GR, etc.)  GR-3317', KB-3329'  11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data  NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING CHANGE PLANS  CHANGE PLANS  CHANGE PLANS  CASING TEST AND CEMENT JOB  OTHER: COMPLETION  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent data, including estimated data of starting any proposed work) SEE RULE 1103.  13. DIVIDE AND GRANDED ALTER CASING TO 3000# FOR 30 MINUTES 06-07-93.  22. UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5286' - 5286' 42 HOLES.  3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 BO IN 11 HRS, 06-09-93.  4. SET RBP @ 5230'. TEST RBP TO 3000M* PERFED W/ 2 JSPF: 5174' 5191', 36 HOLES.  5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 BO IN 5 HRS, 06-11-93.  6. SET RPB @ 5136'. TEST RBP TO 3000M* PERFED W/ 2 JSPF: 5174' 5191', 36 HOLES.  7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 BO IN 5 HRS, 06-11-93.  8. TOH WITH RBP. THE WITH 2 7/8 TUBING, RODS AND PUMP.  9. PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS, 06-17-93.  10. TESTING  Chia space for State Use)  ORIGINAL SIGNED BY JUBINAL SIGN	3. Address of Operator P. O. Box 3109 Midland, Texas 79702	
10.   Elevation (Show whather DF, RKB, RT, GR, etc.)   GR-3317', KB-3329'   11.   Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO:   SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER. OTHER. OTHER. COMPLETION  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.  1. MIRU SERVICE UNIT CLEAN OUT TO PBTD © 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  2. UINON RAN GR-CCL. PERFED W / 2 JSPF: 5266' - 5286'. 42 HOLES. 3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 BD IN 11 HRS. 06-09-93. 4. SET RBP © 5230'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 5174' - 5191'. 36 HOLES. 5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. 6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 5108' - 5124'. 34 HOLES. 7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93. 8. TOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP. 9. PUMPED 55 BD, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.  1. Inereby certify that the information above is true and complete to the best of my knowledge and belief.  **MONATURE**  **TIME**  **DRILLLING OPERATIONS MANAGER**  **DATE OF PRINT NAME**  **CP. BASHAM**  **TILEHENDE NO. 915-68846*  **Chia space for State Use)*  **ORIGINAL SIGNED BY 100-06-07-07-07-07-07-07-07-07-07-07-07-07-07-	10. Elevation (Show whether Digital GR-3317', KB-3329'  11. Check Appropriate Box to Indicate Na	ture of Notice, Report, or Other Data
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT  PULL OR ALTER CASING CASING TEST AND CEMENT JOB  OTHER: COMPLETION  THER: COMPLETION  OTHER: COMPLETION  OTHER: COMPLETION  IDENTIFY THE COMPLETION  IDENTIFY TO SOUND TO PBTD © 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5286' - 5286', 42 HOLES.  JOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 BO IN 11 HRS. 06-09-93.  SET RBP © 5230'. TEST RBP TO 3000#, PERFED W/ 2 JSPF: 5174' - 5191'. 36 HOLES.  DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 BO IN 5 HRS. 06-11-93.  SET RBP © 5136'. TEST RBP TO 3000#, PERFED W/ 2 JSPF: 5108' - 5124'. 34 HOLES.  DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93.  STOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP.  PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.  Intertity contify that the information above is true and complete to the best of my knowledge and bolid.  TIME DRILLING OPERATIONS MANAGER  DATE OF 21-93  THE OR PROTINGME C.P. BASHAM  TELEPHONE NO. 915-68846		
CASING TEST AND CEMENT JOB  OTHER: OTHER: COMPLETION  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.  1. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  2. UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5266' - 5286'. 42 HOLES.  3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 BO IN 11 HRS. 06-09-93.  4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5174' - 5191'. 36 HOLES.  5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 BO IN 5 HRS. 06-11-93.  6. SET RBP @ 5136'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5108' - 5124'. 34 HOLES.  7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93.  8. TOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP.  9. PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.  10. TESTING  1 hereby contify the information above is true and complete to the best of my knowledge and belief.  SIGNATURE		
OTHER: OTHER: OTHER: COMPLETION  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 1103.  1. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  2. UNION RAN GR-CCL. PERFED W / 2 JSPF: 5286'. 42 HOLES.  3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 B0 IN 11 HRS. 06-09-93.  4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 5174' - 5191'. 36 HOLES.  5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 B0 IN 5 HRS. 06-11-93.  6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 5108' - 5124'. 34 HOLES.  7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93.  8. TOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP.  9. PUMPED 55 B0, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.  10. TESTING  1 hereby certify that the information aboves is true and complete to the best of my knowledge and belief.  SIGNATURE DATA THE DRILLING OPERATIONS MANAGER DATE 06-21-93  TITLE DRILLING OPERATIONS MANAGER DATE 06-21-93  DATE 06-21-93  DATE 06-21-93  TITLE DRILLING OPERATIONS MANAGER DATE 06-21-93  TITLE DRILLING OPERATIONS MANAGER DATE 06-21-93  TITLE DRILLING OPERATIONS MANAGER DATE 06-21-93  DATE 06-21-93  DATE 06-21-93  DATE 06-21-93  DATE 06-21-93		
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.  1. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  2. UNION RAN GR-CCL. PERFED W / 2 JSPF: 5266' - 5286', 42 HOLES.  3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 BO IN 11 HRS. 06-09-93.  4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 51074' - 5191', 36 HOLES.  5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 BO IN 5 HRS. 06-11-93.  6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W / 2 JSPF: 5108' - 5124'. 34 HOLES.  7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93.  8. TOH WITH RBP. TH WITH 2 7/8 TUBING, RODS AND PUMP.  9. PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.  10. TESTING  1 hereby certify that the information above is true and complete to the best of my knowledge and belief.  SIGNATURE		
1. MIRU SERVICE UNIT CLEAN OUT TO PBTD @ 5380'. TESTED CASING TO 3000# FOR 30 MINUTES 06-07-93.  2. UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5266' - 5286'. 42 HOLES. 3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 B0 IN 11 HRS. 06-09-93. 4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5174' - 5191'. 36 HOLES. 5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 B0 IN 5 HRS. 06-11-93. 6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5108' - 5124'. 34 HOLES. 7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93. 8. TOH WITH RBP. THE WITH 2 7/8 TUBING, RODS AND PUMP. 9. PUMPED 55 B0, 25 BLW, 200 MCF IN 24 HRS. 06-17-93. 10. TESTING  Thereby certify that the information above is true and complete to the best of my knowledge and belief.  SIONATURE  TITLE DRILLING OPERATIONS MANAGER  DATE 06-21-93  TITLE DRILLING OPERATIONS MANAGER  THE OR PRINT NAME C.P. BASHAM  TELEPHONE NO. 915-68846		VIIII
2. UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5266' - 5286'. 42 HOLES. 3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SWAB 51 B0 IN 11 HRS. 06-09-93. 4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5174' - 5191'. 36 HOLES. 5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SWAB 55 B0 IN 5 HRS. 06-11-93. 6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W/ 2 JSPF: 5108' - 5124'. 34 HOLES. 7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93. 8. TOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP. 9. PUMPED 55 B0, 25 BLW, 200 MCF IN 24 HRS. 06-17-93. 10. TESTING  1 hereby certify that the information above is true and complete to the best of my knowledge and belief.  SIONATURE	work) SEE RULE 1103.	
TYPE OR PRINT NAME C.P. BASHAM  TELEPHONE NO. 915-68846  (This space for State Use) ORIGINAL SIGNED BY JUNEY STATE OF THE DISTRICT I SUPERVISOR  DISTRICT I SUPERVISOR  THE DRILLING OPERATIONS MANAGER  DATE 06-21-93  THE DRILLING OPERATIONS MANAGER  DATE USE 06-21-93  THE DRILLING OPERATIONS MANAGER  DATE 06-21-93	2. UNION RAN GR-CCL. PERFED W/ 2 JSPF: 5266' - 5286'. 4 3. DOWELL ACIDIZED WITH 600 GAL 15% HCL 06-08-93. SW/ 4. SET RBP @ 5230'. TEST RBP TO 3000#. PERFED W/ 2 JSF 5. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-11-93. SW/ 6. SET RPB @ 5136'. TEST RBP TO 3000#. PERFED W/ 2 JSF 7. DOWELL ACIDIZED WITH 500 GAL 15% HCL 06-14-93. 8. TOH WITH RBP. TIH WITH 2 7/8 TUBING, RODS AND PUMP. 9. PUMPED 55 BO, 25 BLW, 200 MCF IN 24 HRS. 06-17-93.	12 HOLES. AB 51 BO IN 11 HRS. 06-09-93. PF: 5174' - 5191'. 36 HOLES. AB 55 BO IN 5 HRS. 06-11-93.
(This space for State Use) ORIGINAL SIGNED BY UNDER DEVELOPED DISTRICT I SUPERVISOR	SIGNATURE C. Y. Basham SAH TITLE	DRILLING OPERATIONS MANAGER DATE 06-21-93
DISTRICT I SUPERVISOR		
	DISTRICT I SUPERVISOR	DATE UN 2 4 1993

APPROVED BY ----